




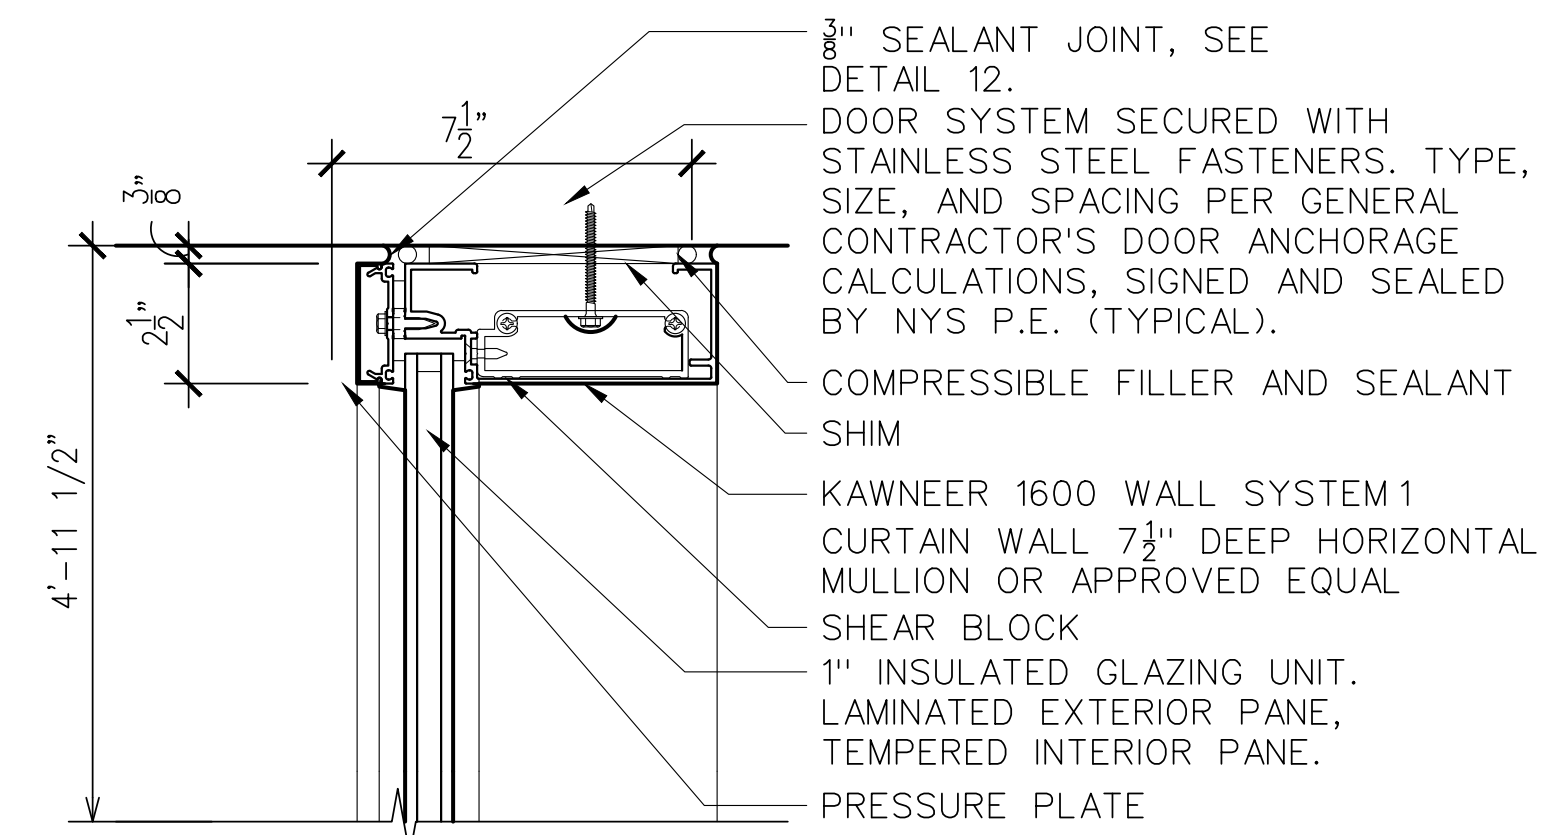

CURTAIN WALL DETAIL -
1 TOP RAIL

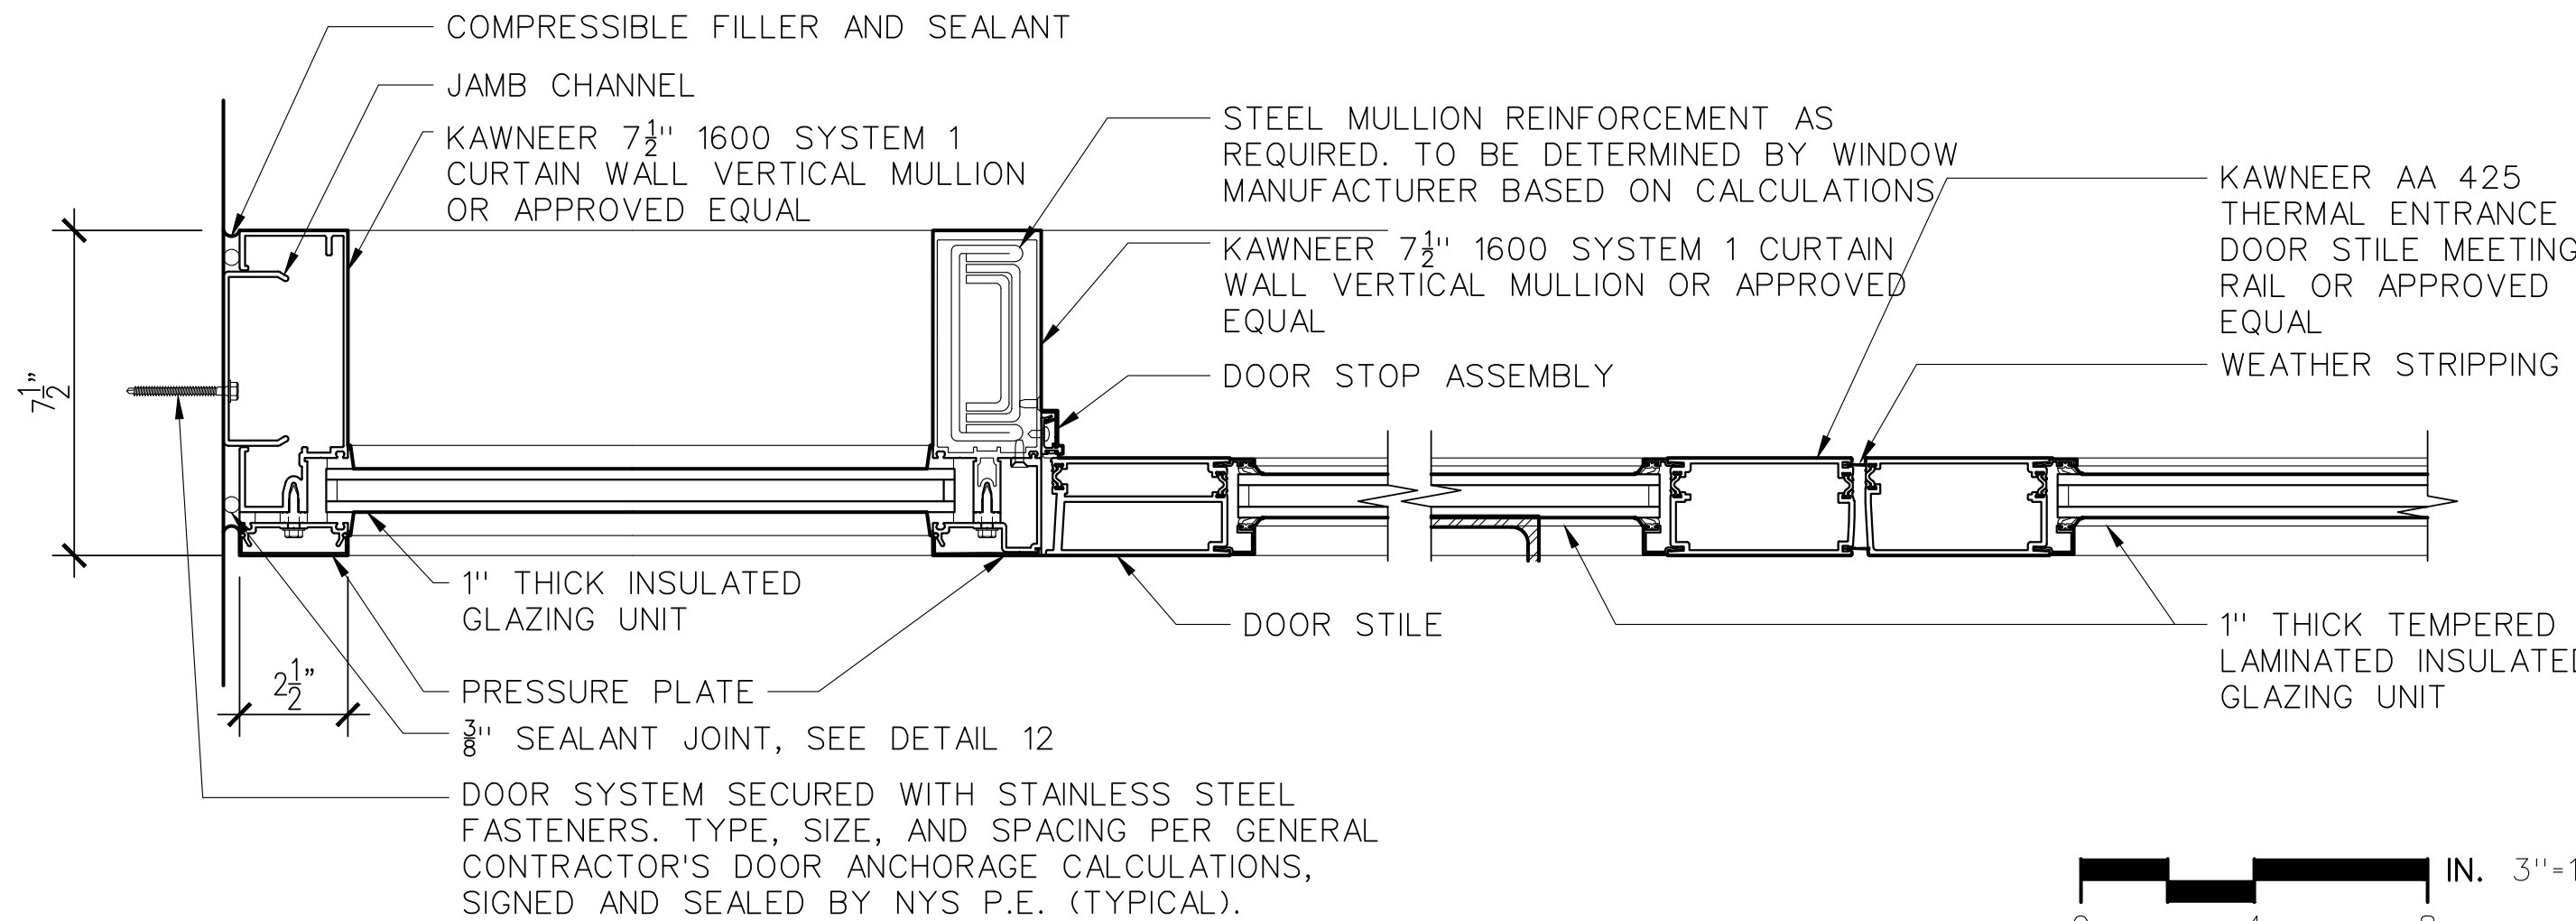


CURTAIN WALL
6 DETAIL - JAMB

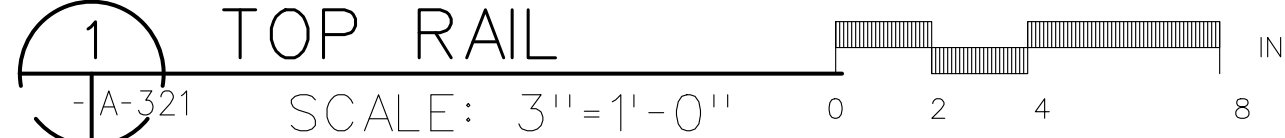



CURTAIN WALL
7 DETAIL - DOOR JAMB





CURTAIN WALL DETAIL -
8 DOOR MEETING STILES

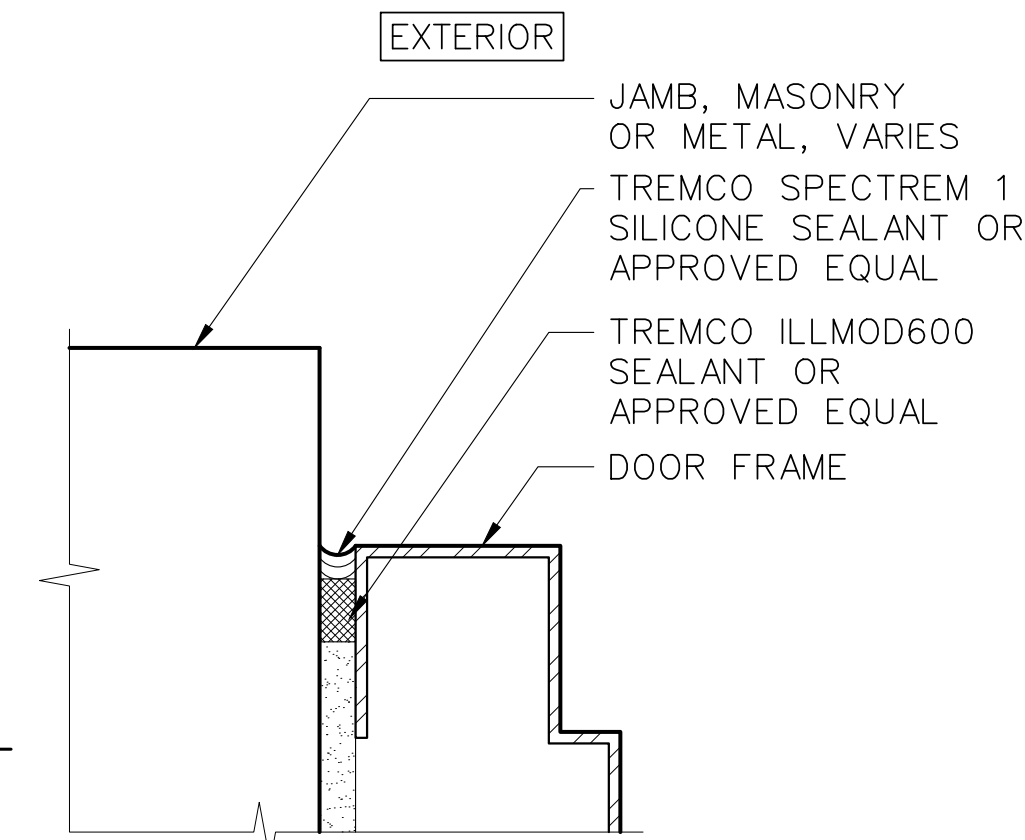



12 DOOR SEALANT DETAIL

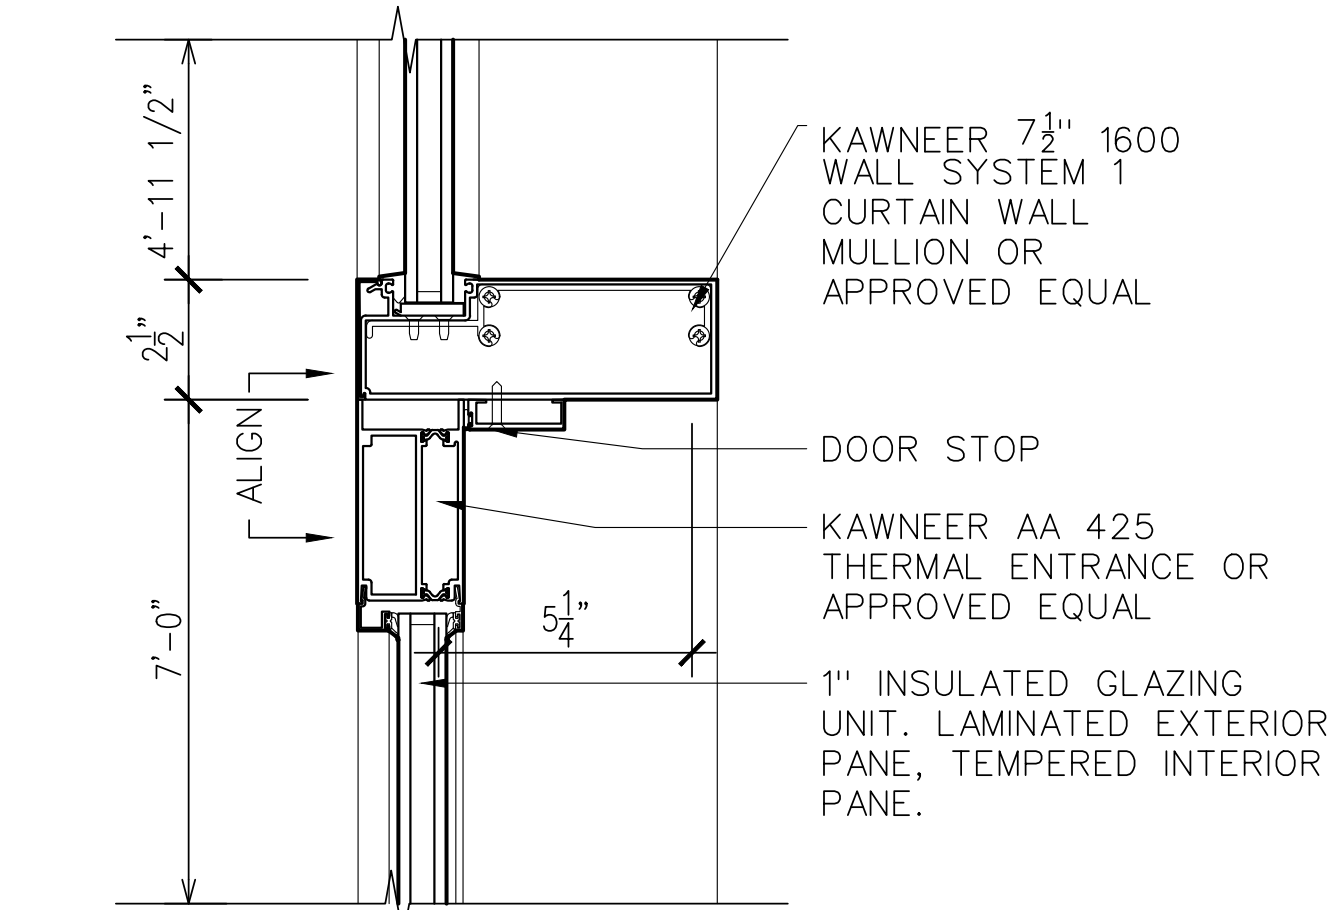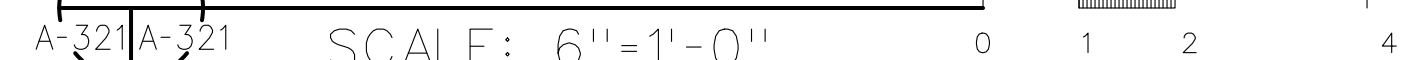


CURTAIN WALL DETAIL -
2 DOOR HEAD

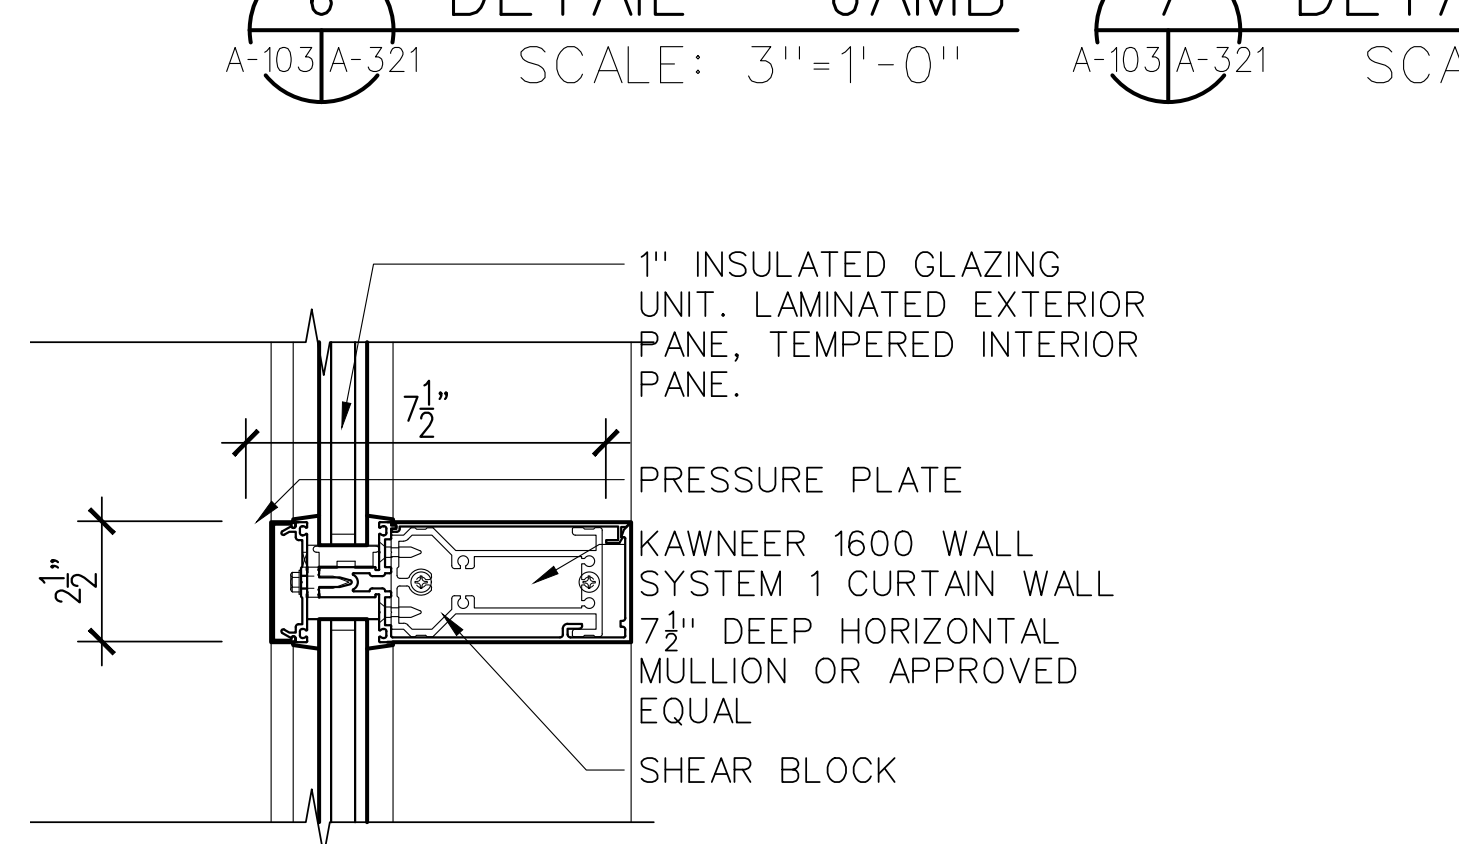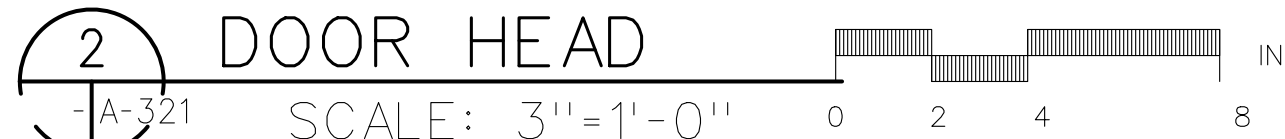


CURTAIN WALL DETAIL -
4 HORIZONTAL MULLION

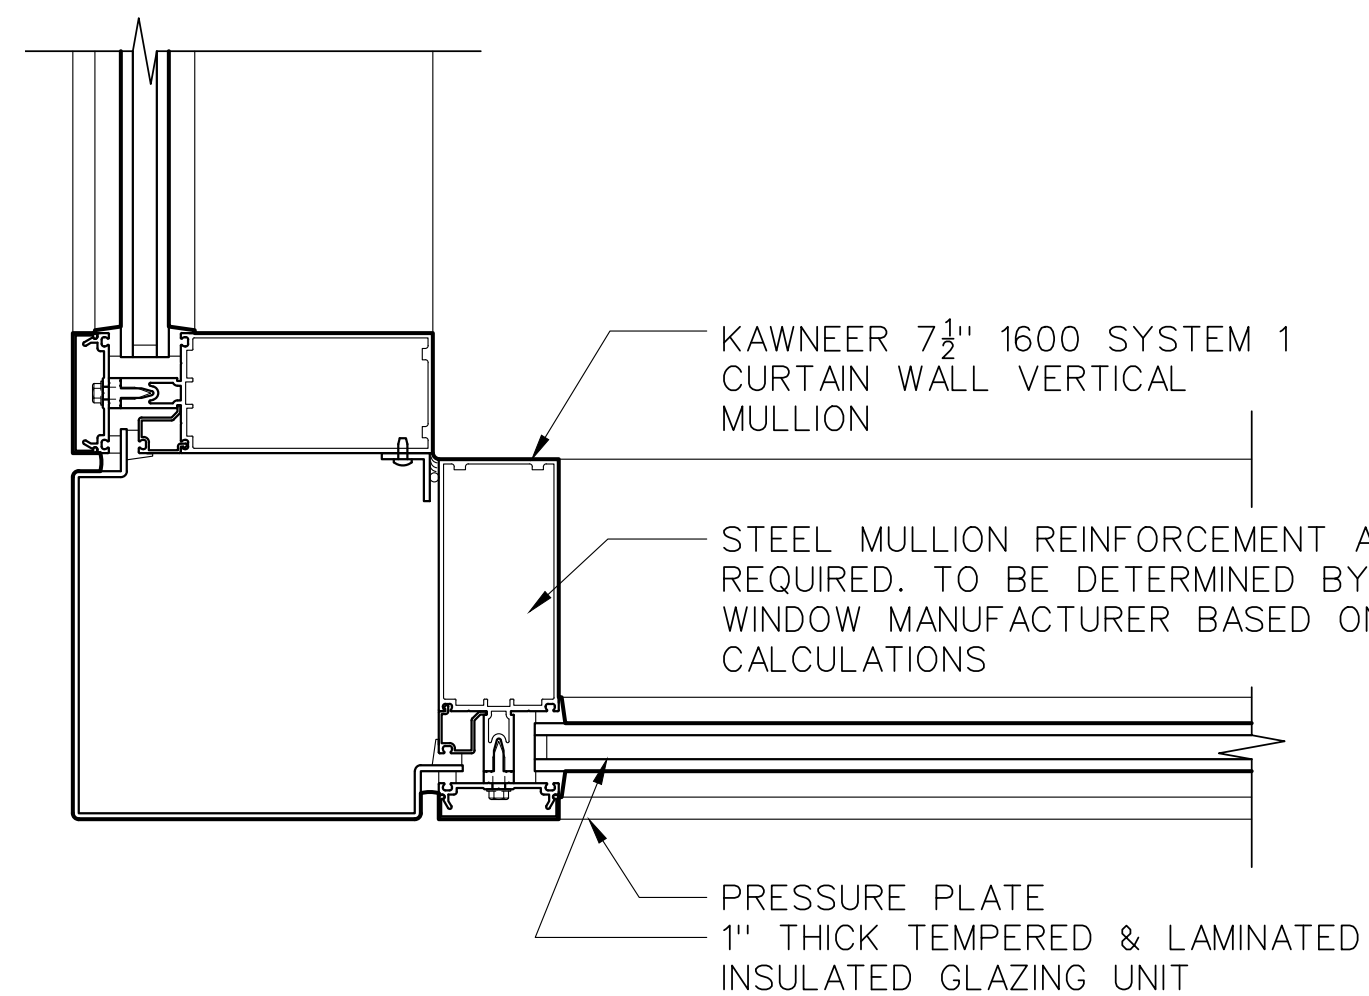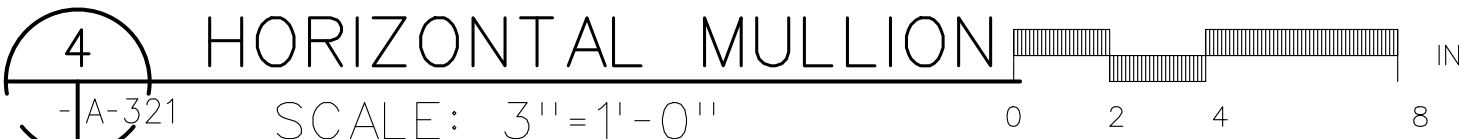



CURTAIN WALL DETAIL -
10 CORNER MULLION

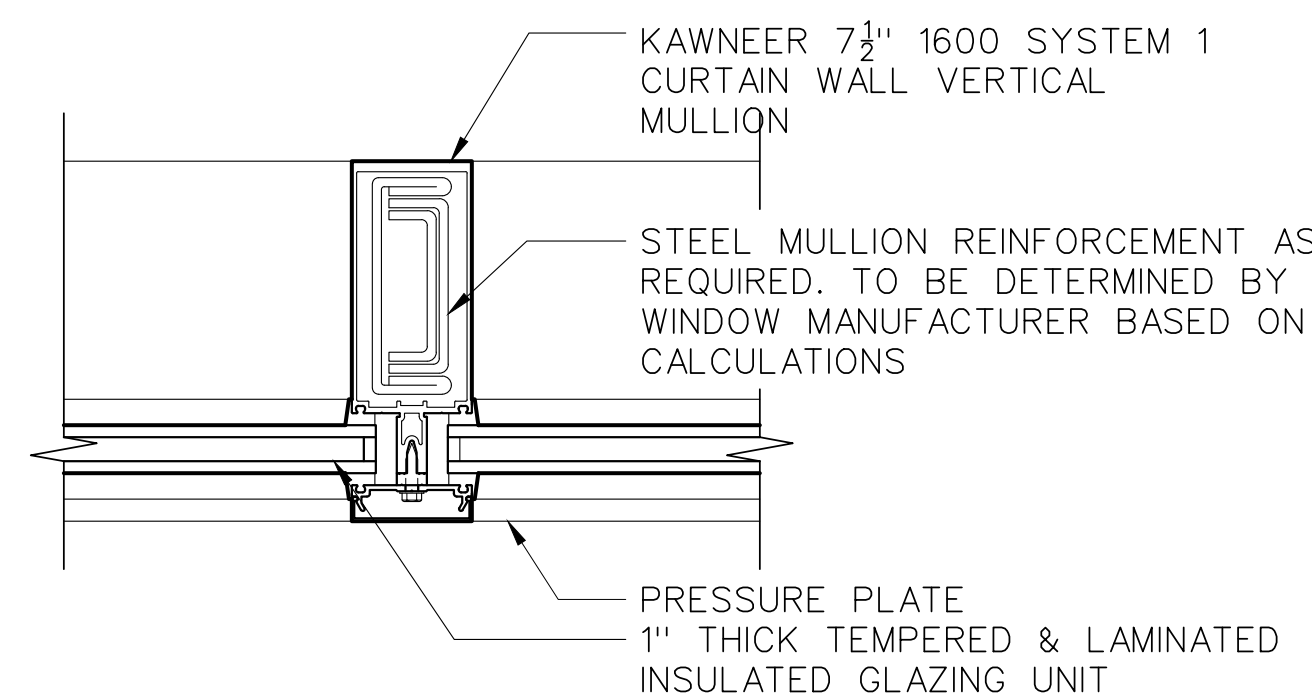


CURTAIN WALL DETAIL -
11 VERTICAL MULLION

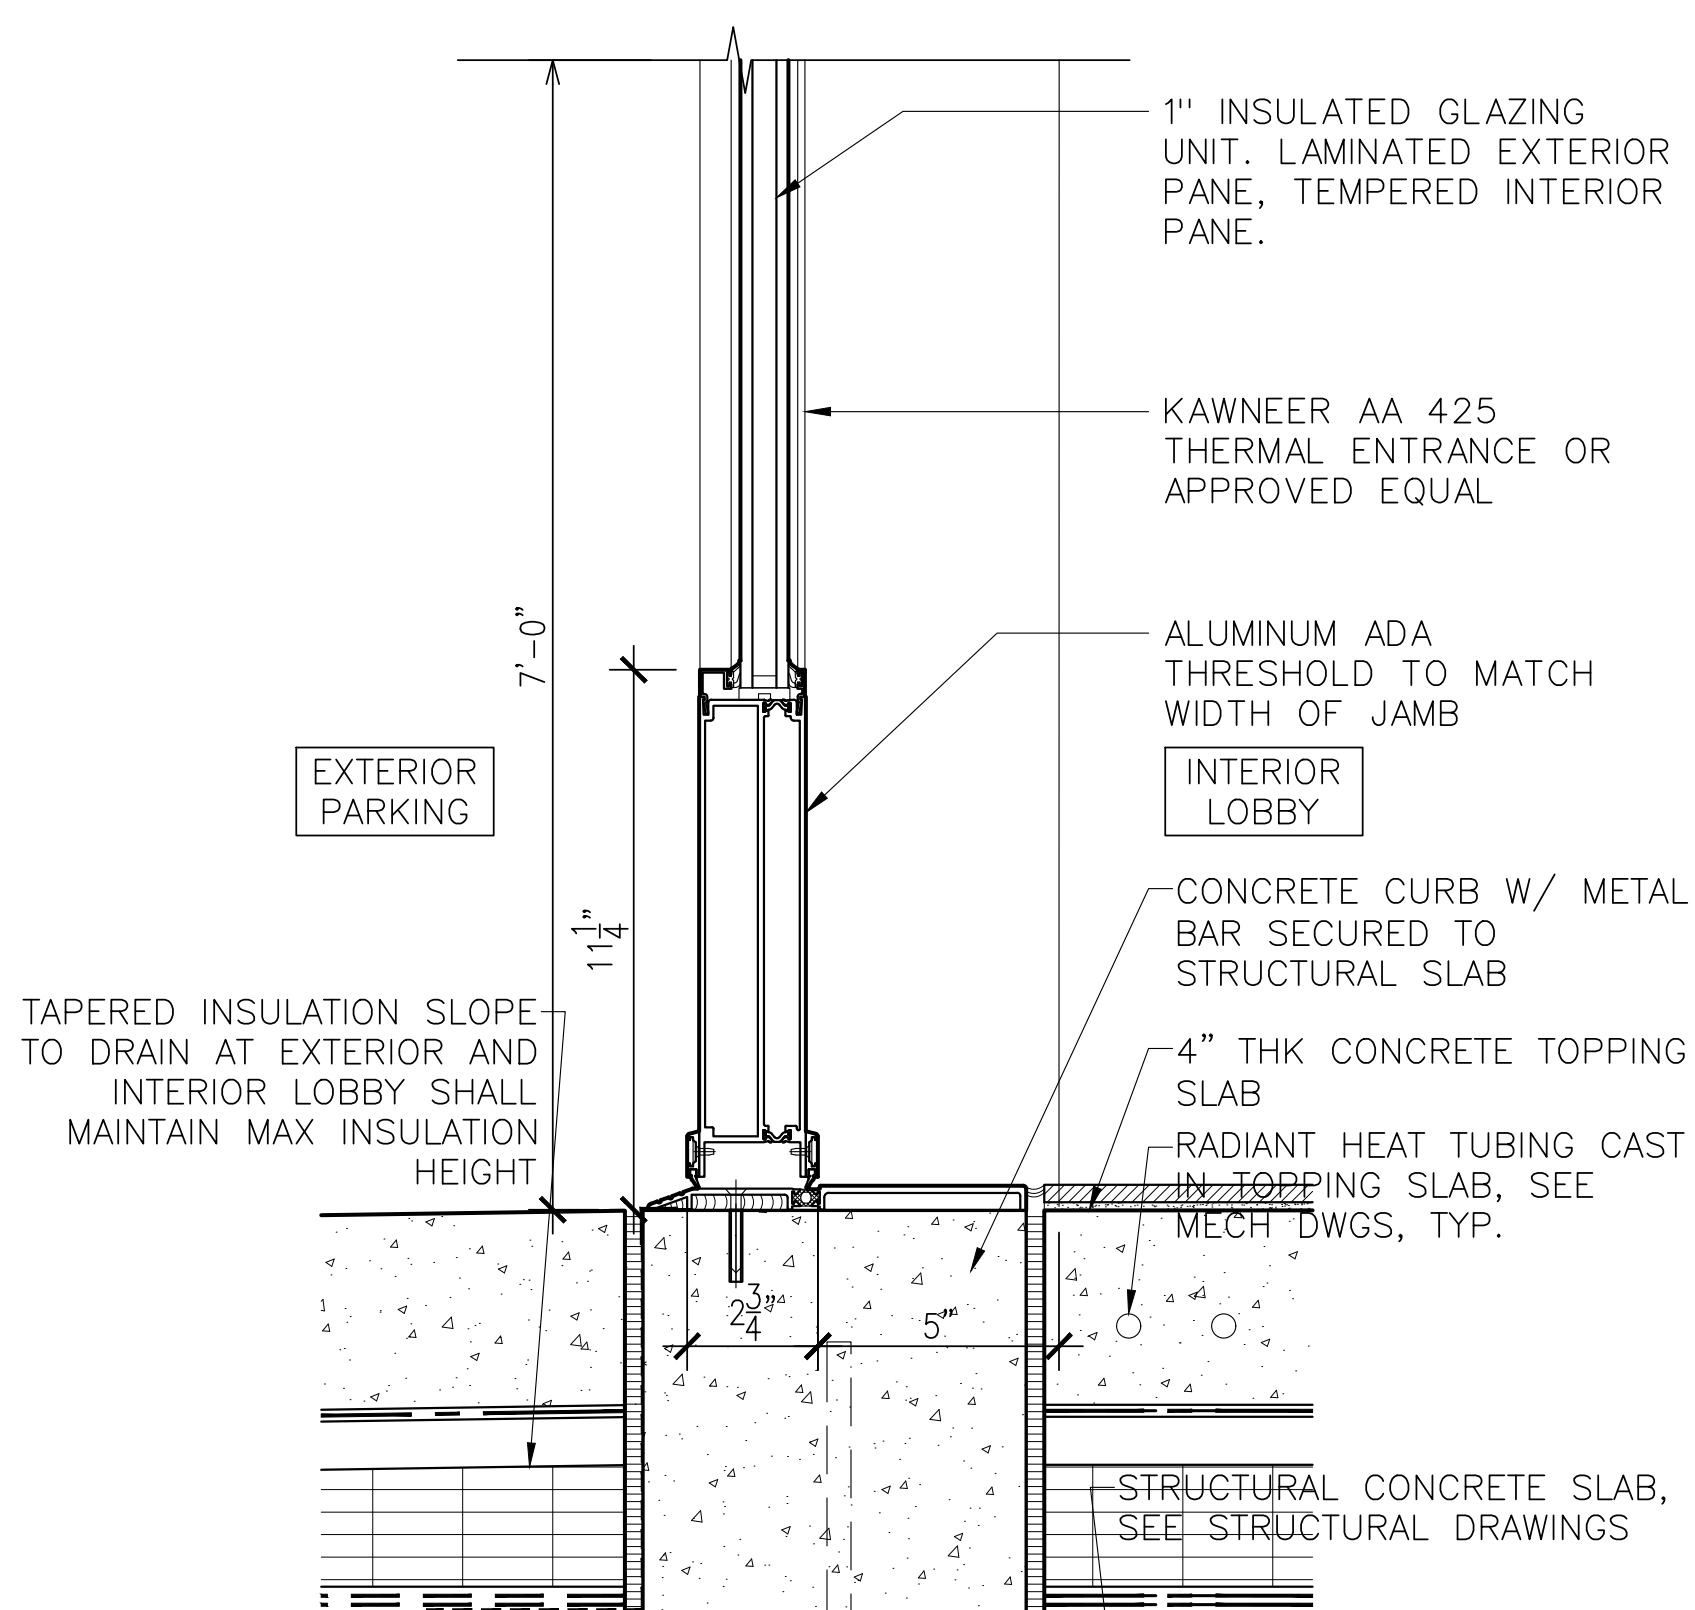

CURTAIN WALL DETAIL -
3 DOOR SILL

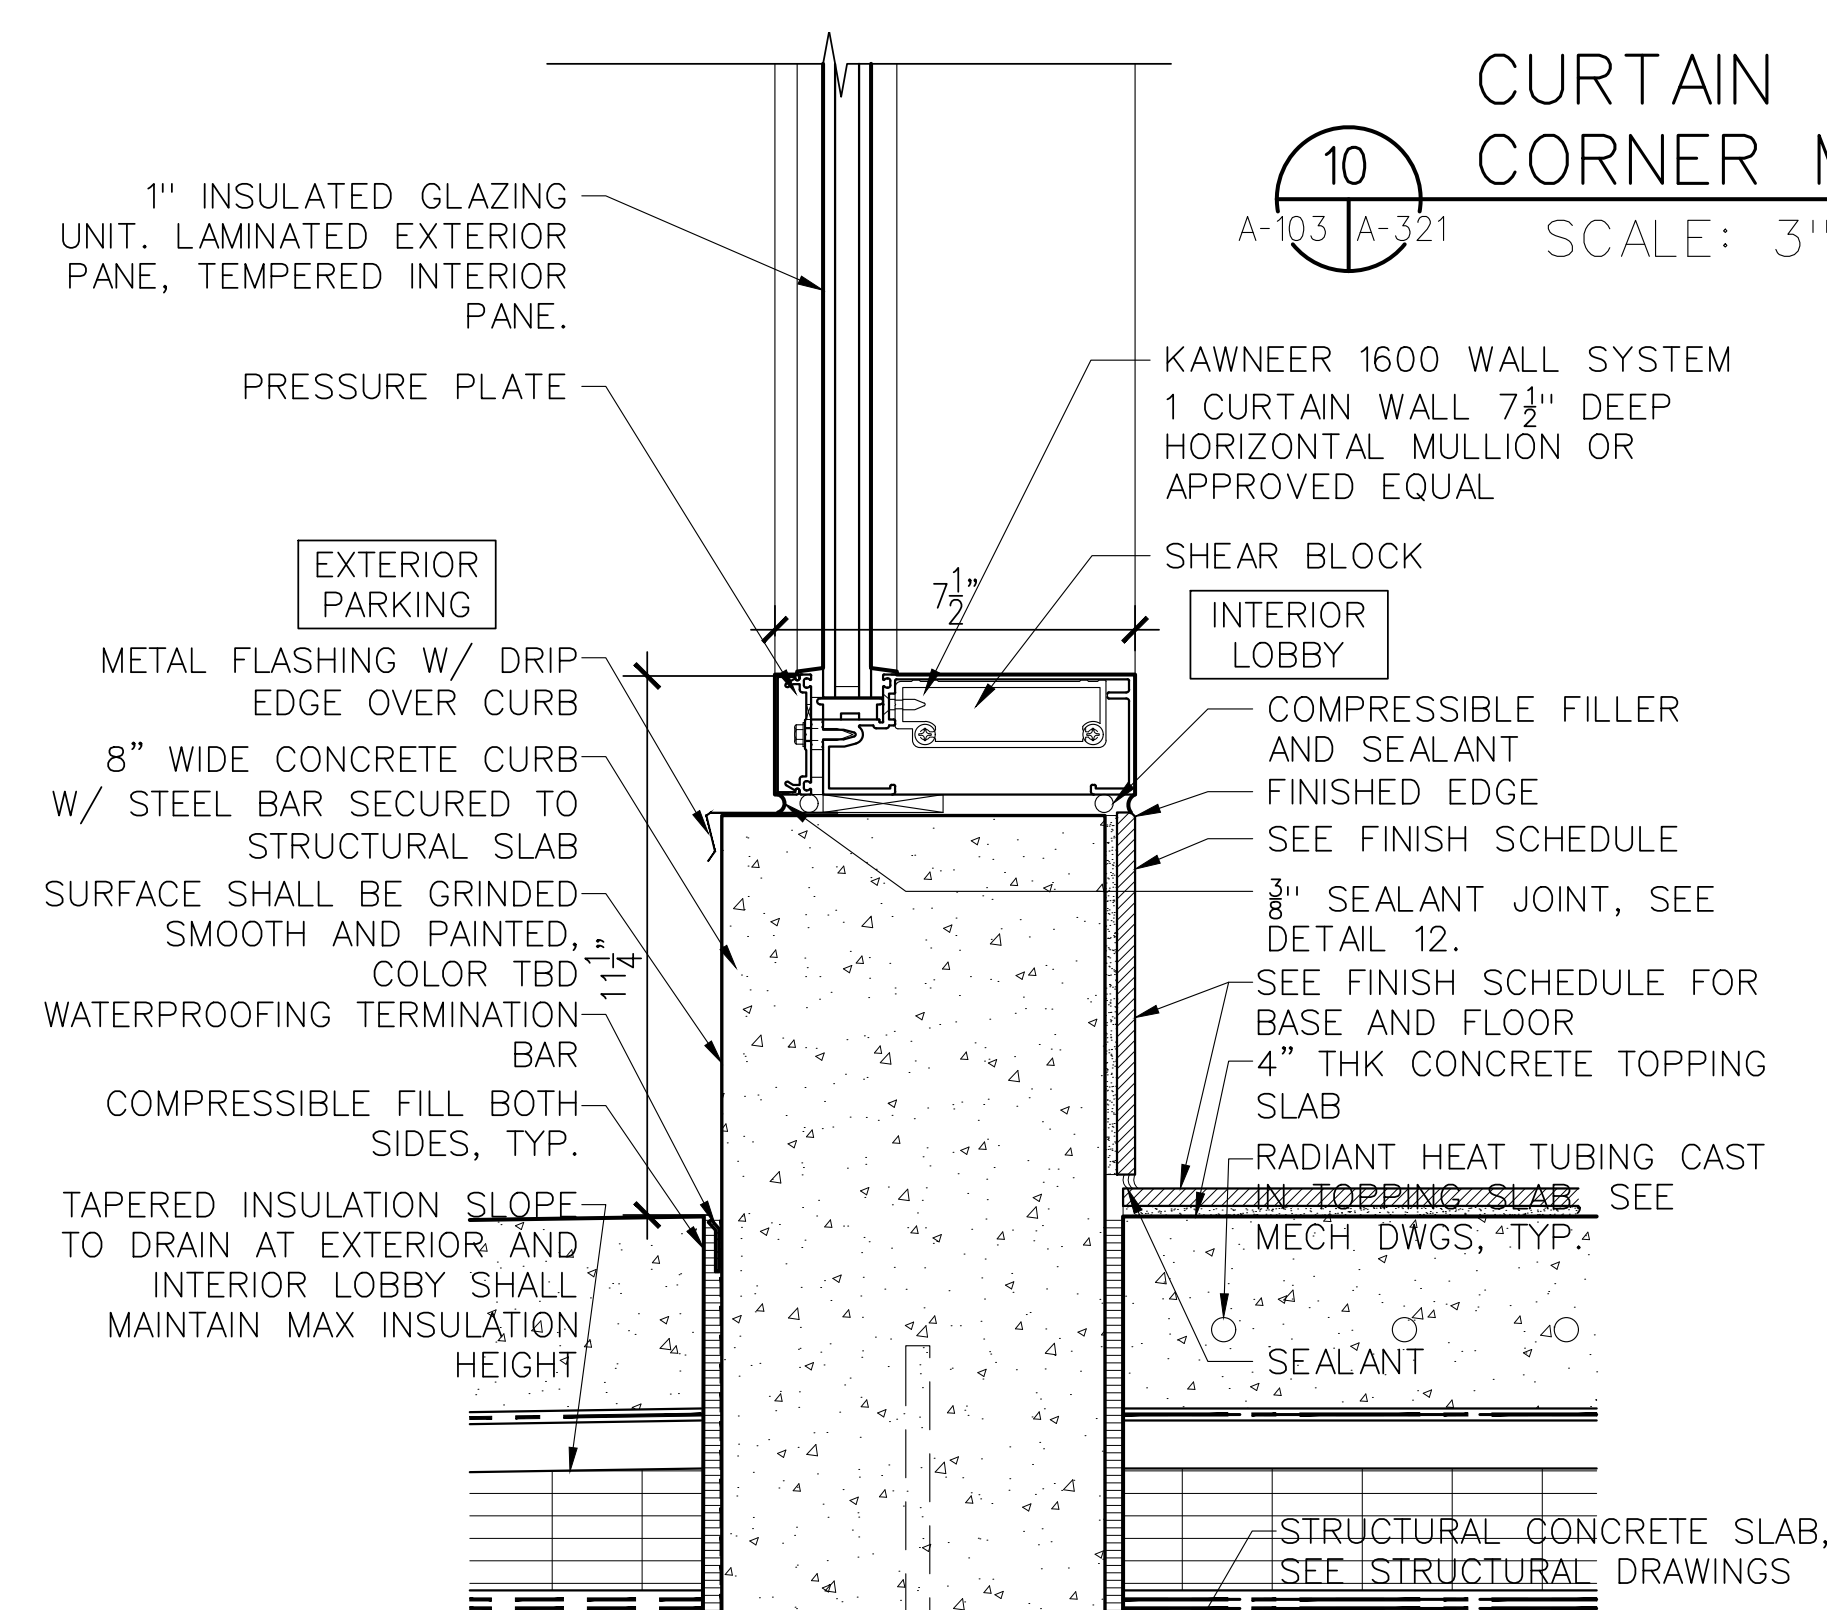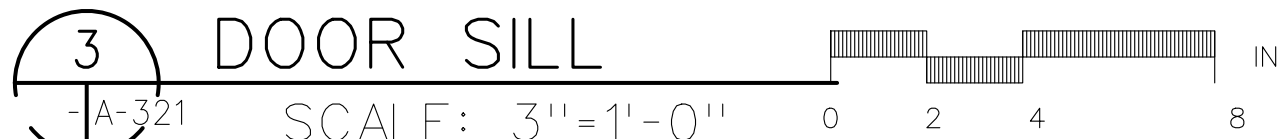

CURTAIN WALL DETAIL -
5 BOTTOM RAIL

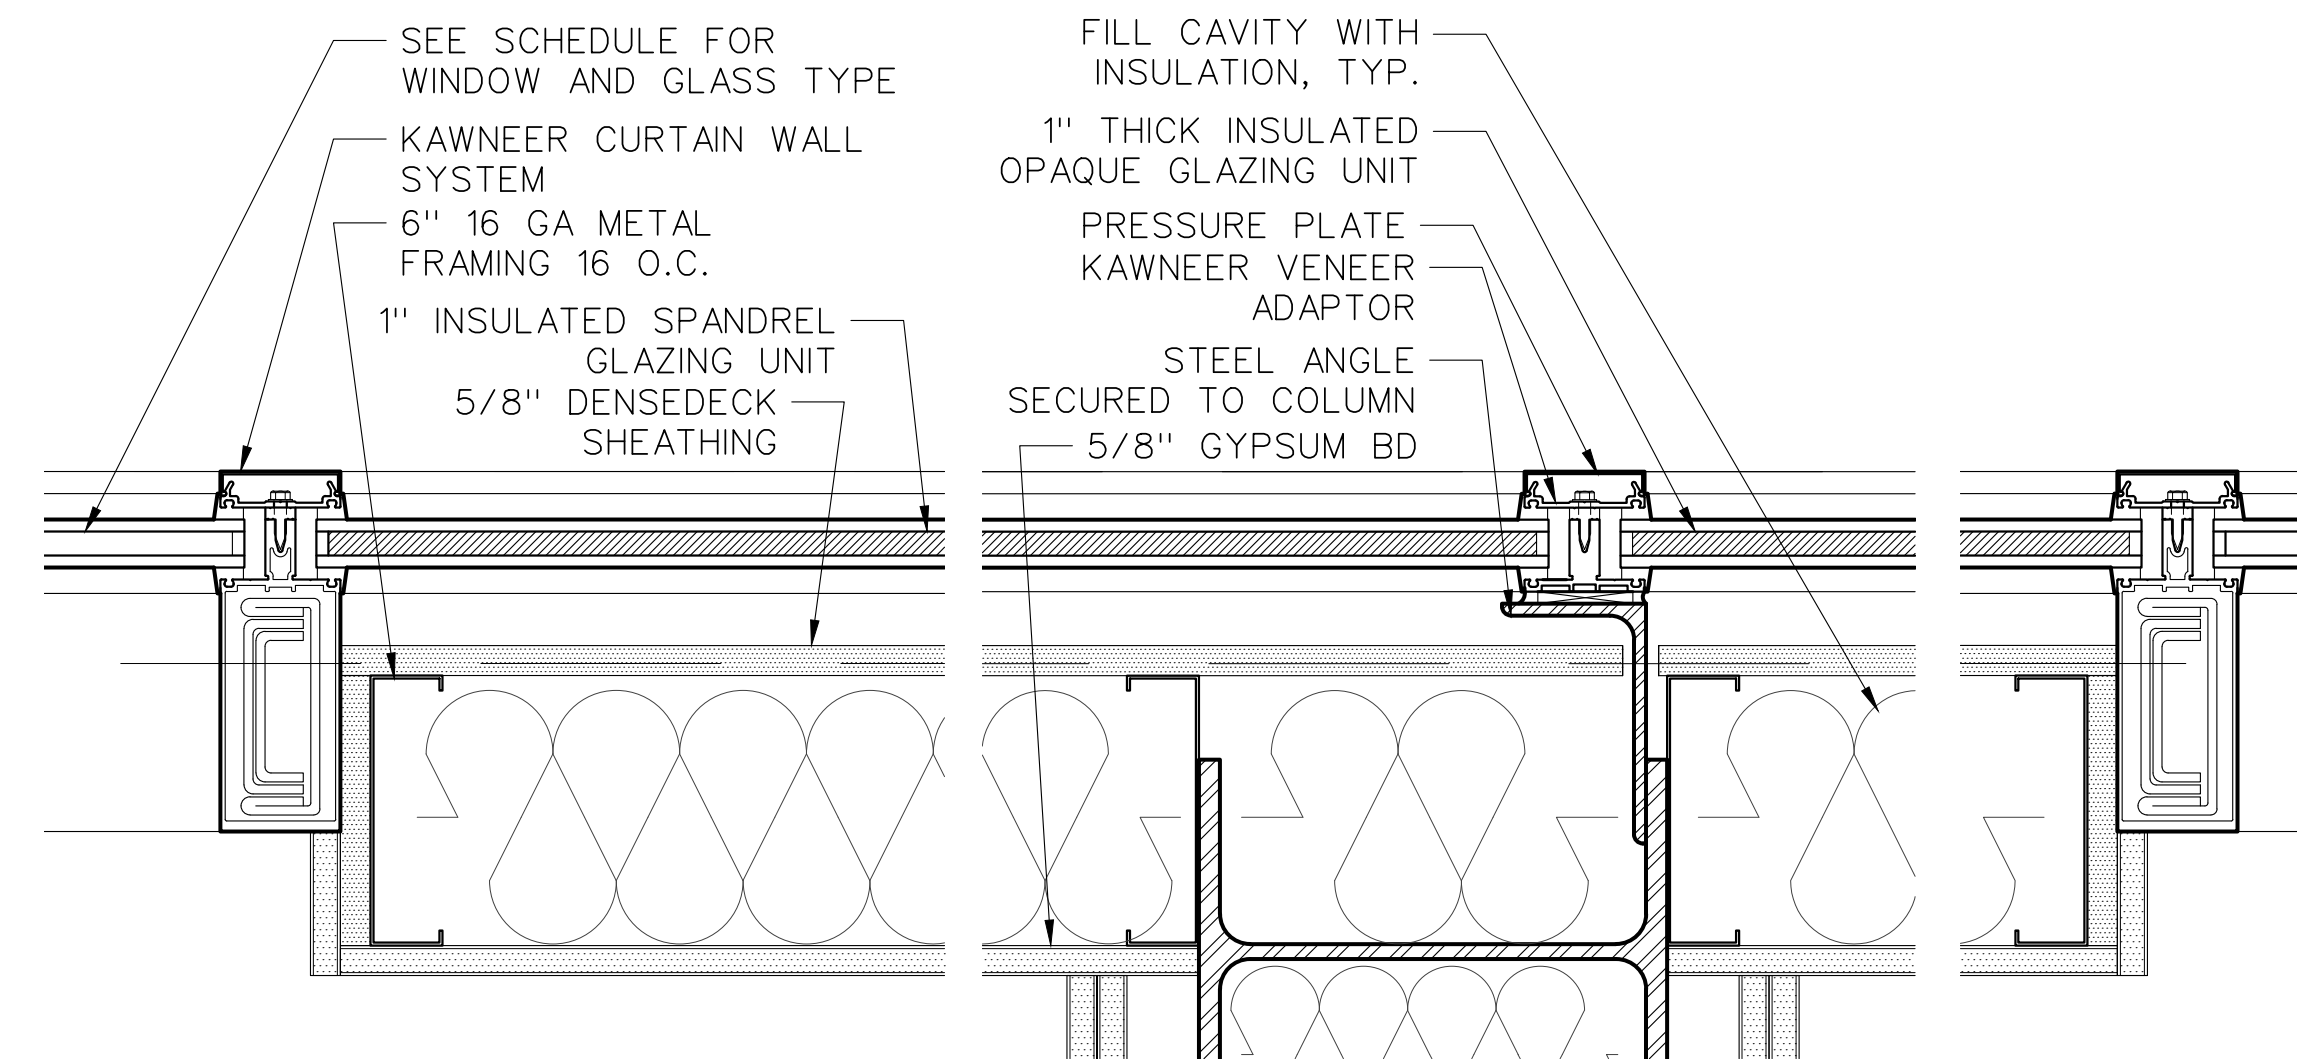

CURTAIN WALL VENEER
5 AT PERIMETER COLUMN



ARCHITECT
di Domenico + Partners LLP
Architecture
Landscape Architecture
Planning
3743 Crescent Street, 3rd Floor
Long Island City, New York 11101
Tel 212-337-0400
Fax 212-337-3567

CIVIL PLANNING ENGINEER
JMC
JMC Planning Engineering Landscape
Architecture & Land Surveying, PLLC
120 Bedford Road
Armonk, New York 10504
Tel 914-273-5225
Fax 914-273-2102

MEP ENGINEER
Burns BURNS ENGINEERING, PC.
1261 Broadway, Suite 708
New York, New York 10001
Tel 212-962-3503

STRUCTURAL ENGINEER
GEI GEI50
1385 Broadway, 20th FL
New York, New York 10018
Tel 212-687-8262



MANHATTAN BEER DISTRIBUTORS
20 DUNNIGAN DRIVE
SUFFERN, NEW YORK

REV	DESCRIPTION	DATE
-	ISSUED FOR DOB SUBMISSION	9.10.21
-	ISSUED FOR BID	10.15.21
-	ISSUED FOR CONSTRUCTION	11.30.21
-	REVISED BID SET	01.20.22
-	REVISED FOR CONSTRUCTION	04.05.22
-	PER METAL PANEL REDESIGN	07.26.22
-	REVISED FOR CONSTRUCTION	08.15.22

DRAWN BY: S. WOO
CHECKED BY: D. TOBAR, R.A.
APPROVED BY: A. BERGER, R.A.
DATE: 07.30.2021
SCALE: AS NOTED

DRAWING TITLE:

CURTAIN WALL SYSTEM

DWG NUMBER:

A-321