



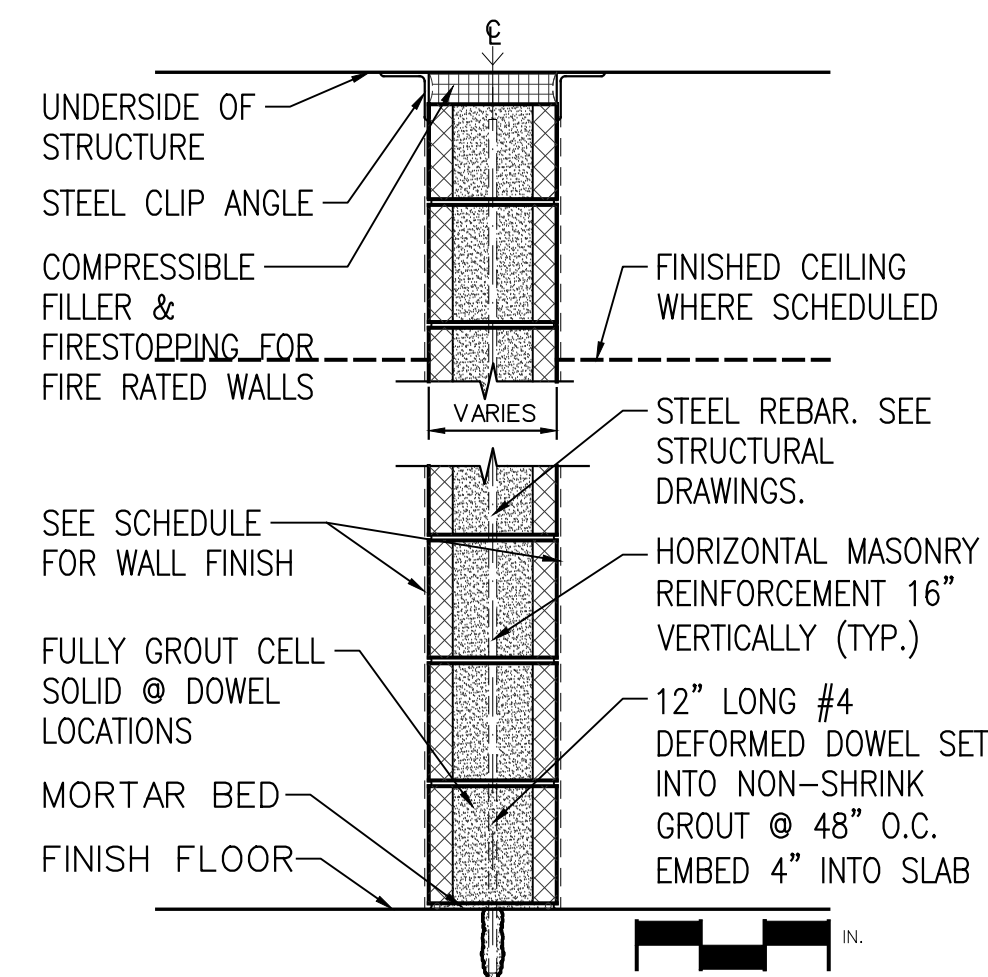


- 1A CMU MASONRY WALL
6" CMU - NON-RATED
- 1B CMU MASONRY WALL
8" CMU - NON-RATED
- 1C CMU MASONRY WALL
6" CMU - 1 HR. RATED (UL U-906)
- 1D CMU MASONRY WALL
8" CMU - 1 HR. RATED (UL U-905)
- 1E CMU MASONRY WALL
6" CMU - 2 HR. RATED (UL U-906)
- 1F CMU MASONRY WALL
8" CMU - 2 HR. RATED (UL U-905)

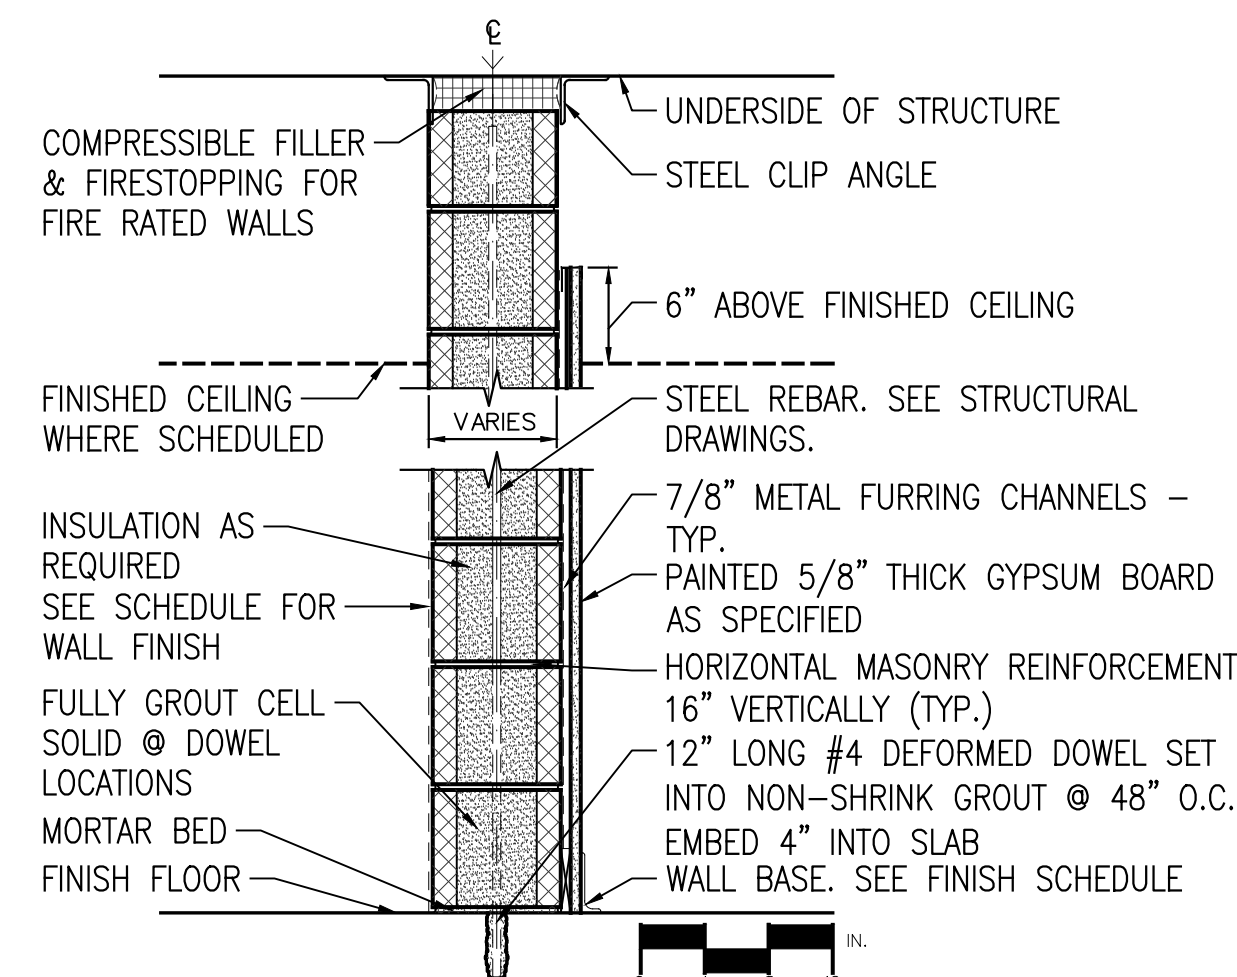


- 2A CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
6" CMU - NON-RATED
- 2B CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
6" CMU - NON-RATED W/ CORE INSULATION
- 2C CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
6" CMU - 1 HR. RATED (UL U-906)
- 2D CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
6" CMU - 2 HR. RATED (UL U-906)
- 2E CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
CORE INSULATION
6" CMU - 2 HR. RATED (UL U-906)
- 2F CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
CORE INSULATION
8" CMU - 1 HR. RATED (UL U-905)
- 2G CMU MASONRY WALL W/ GYP. BOARD 1 SIDE
CORE INSULATION
8" CMU - 2 HR. RATED (UL U-905)


NOTES:
1. FOR 2HR RATING ON 6" CMU/GFB WALLS, ALL UNITS SHALL BE FULLY GROUTED.
2. ALL PAINTED GYPSUM BOARD SHALL BE ABUSE RESISTANT GYPSUM BOARD.
3. PROVIDE FIRE STOPPING AT ALL PENETRATIONS ON ALL RATED WALLS/FLOORS/CEILINGS PER THE RATED ASSEMBLY OR GREATER.
4. STUCCO AND INSULATION SHALL BE STOTHERM CI XPS CLASSIC.

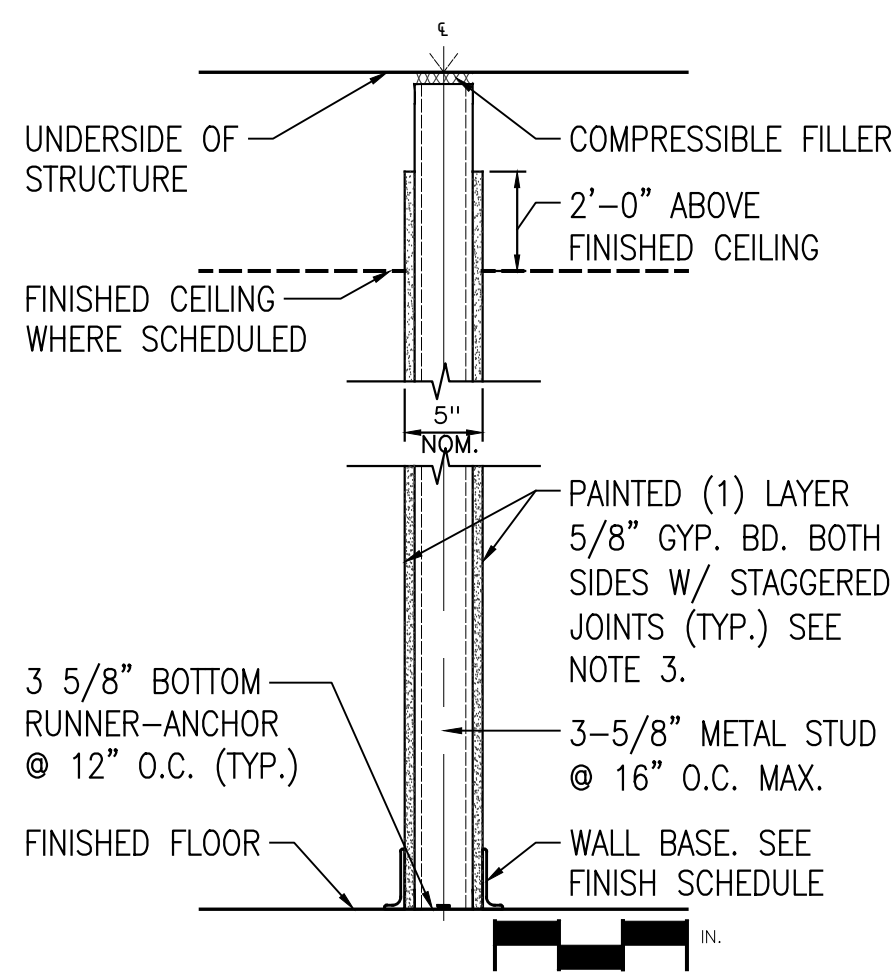


- 3A GYPSUM BOARD WALL PARTITION
NON-RATED
- 3F GYPSUM BOARD WALL PARTITION
NON-RATED (WALL HEIGHT 42")

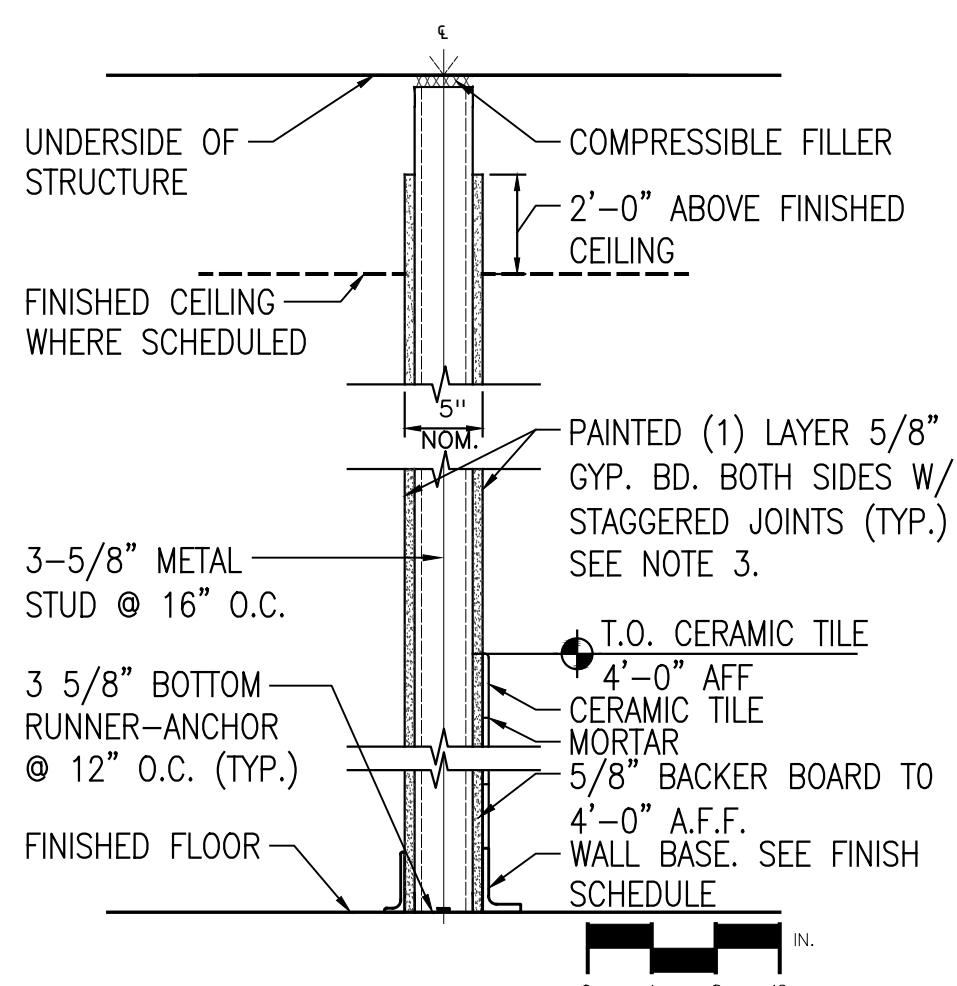


- 4A GYPSUM BOARD WALL PARTITION
GYP. BOARD BOTH SIDES
CERAMIC TILE & BACKER BOARD 1 SIDE
NON-RATED

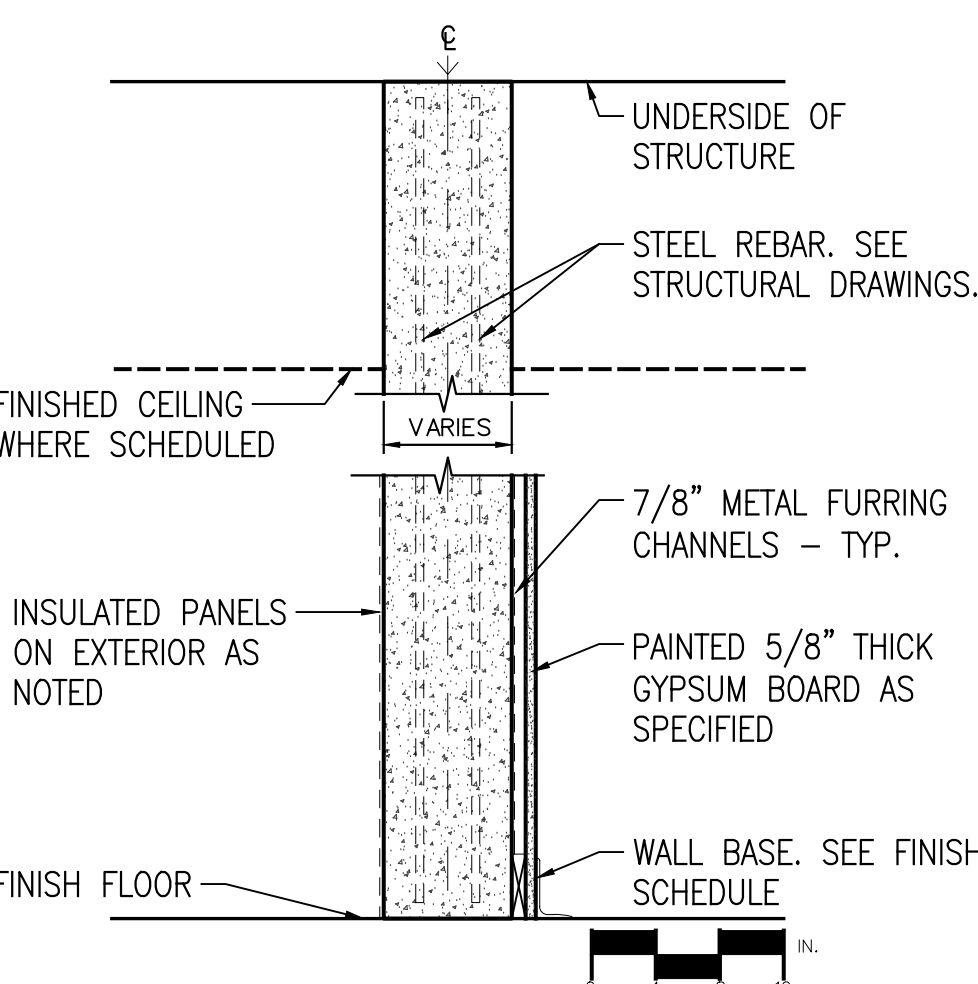


- 5A CONCRETE WALL W/ REINFORCEMENT
GYP. BOARD 1 SIDE
8" CONCRETE - 2 HR. RATED
- 5B CONCRETE WALL W/ REINFORCEMENT
GYP. BOARD 1 SIDE
10" CONCRETE - 2 HR. RATED
- 5C CONCRETE WALL W/ REINFORCEMENT
GYP. BOARD BOTH SIDES
10" CONCRETE - 2 HR. RATED

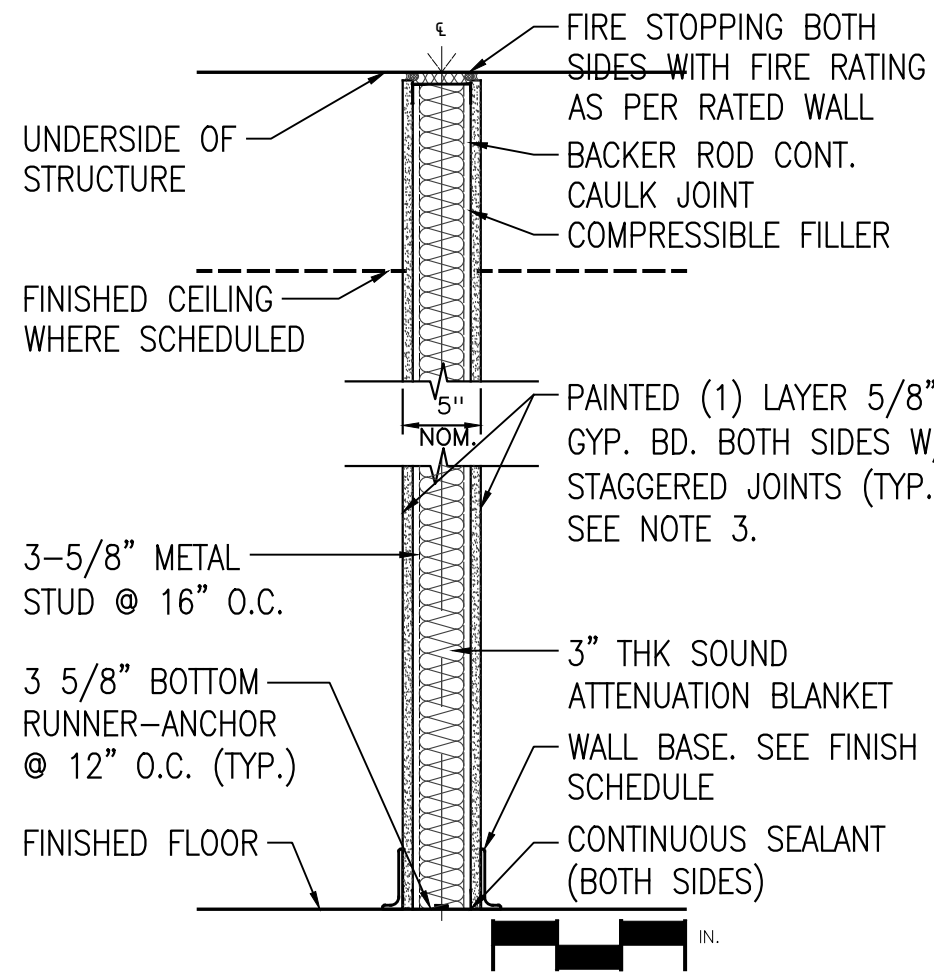


- 3B GYPSUM BOARD WALL PARTITION
W/ SOUND ATTENUATION BLANKET
NON-RATED (STC=55)
- 3C GYPSUM BOARD WALL PARTITION
1 HR RATED (UL-U-419)

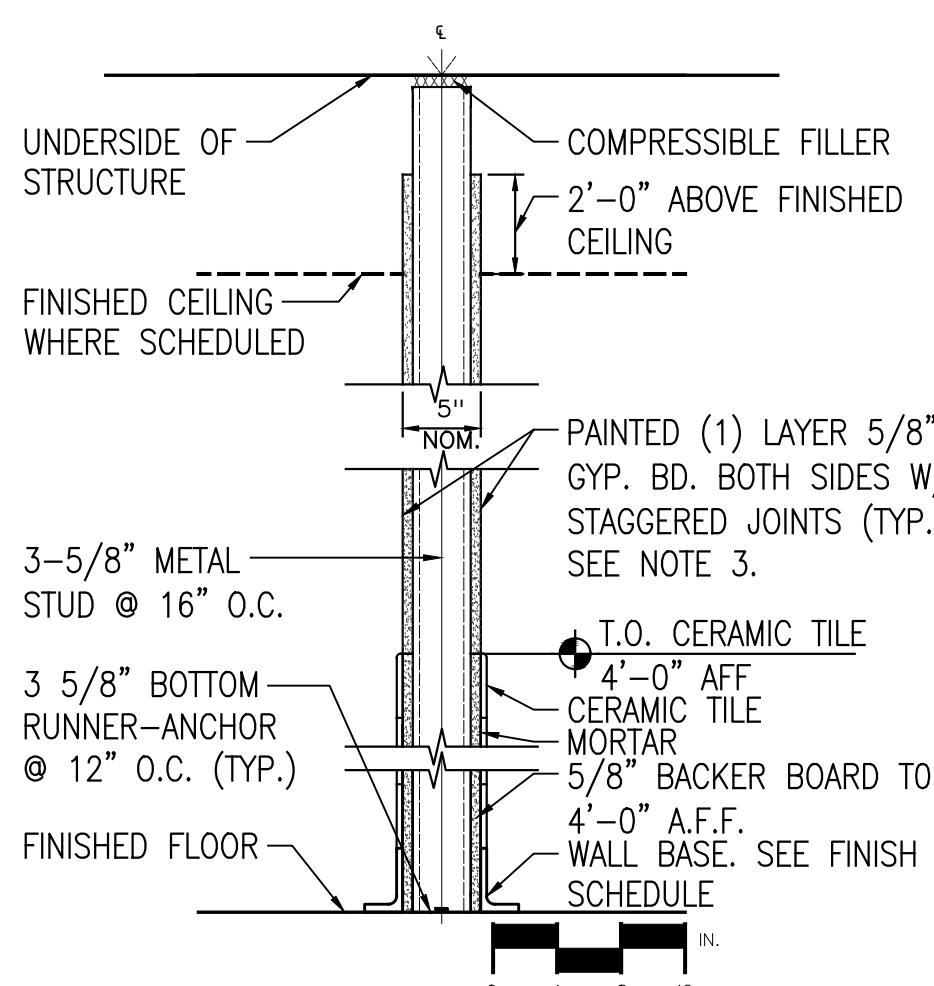


- 4B GYPSUM BOARD WALL PARTITION
GYP. BOARD BOTH SIDES
CERAMIC TILE & BACKER BOARD BOTH SIDES
NON-RATED

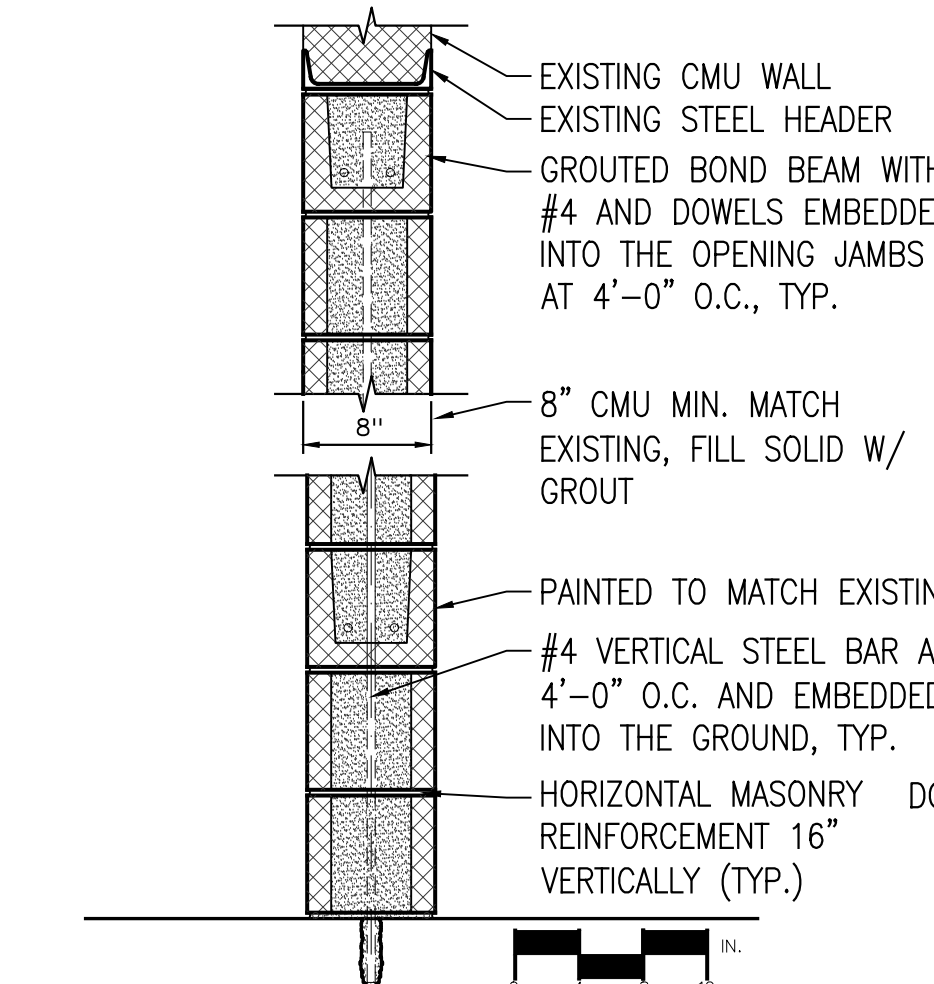


- 6 CONCRETE WALL INFILL W/ REINFORCEMENT
MINIMUM 8" GROUTED CONCRETE BLOCK
2 HR RATED

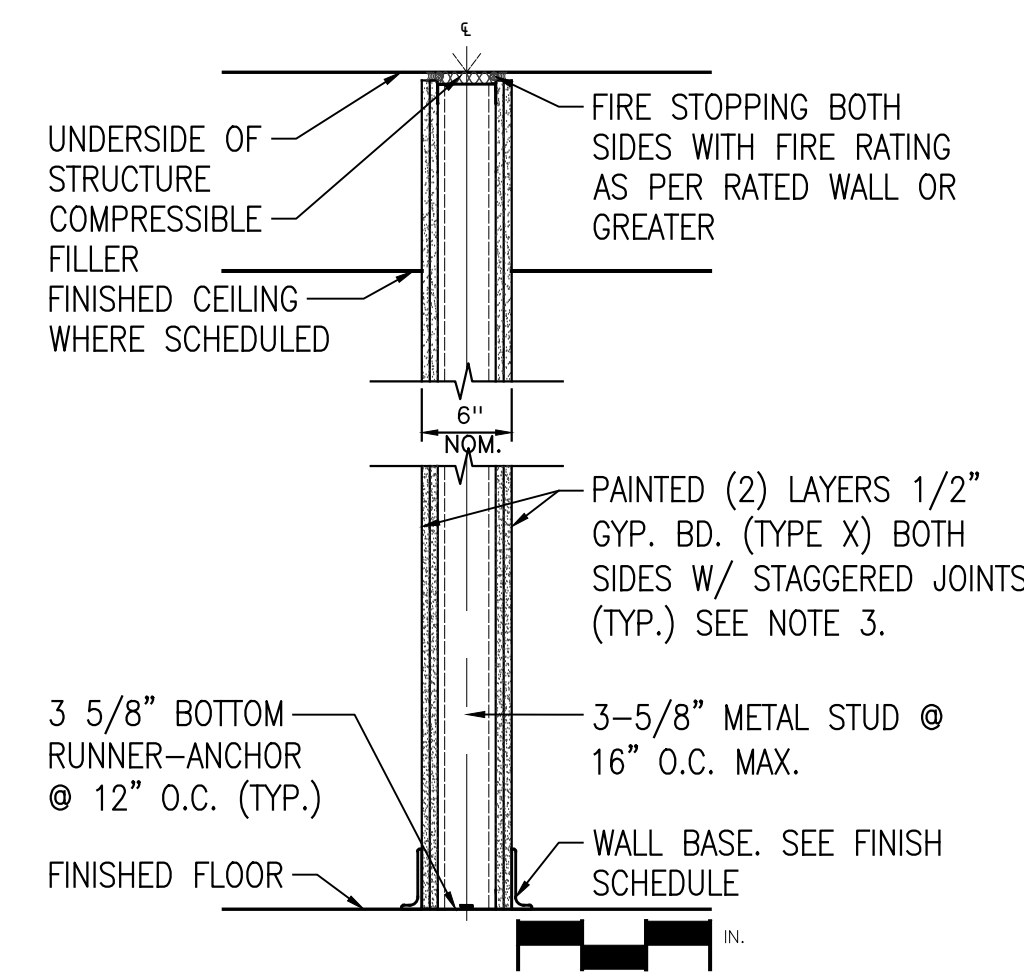


- 3D GYPSUM BOARD WALL PARTITION
2 HR. RATED (UL U-419)

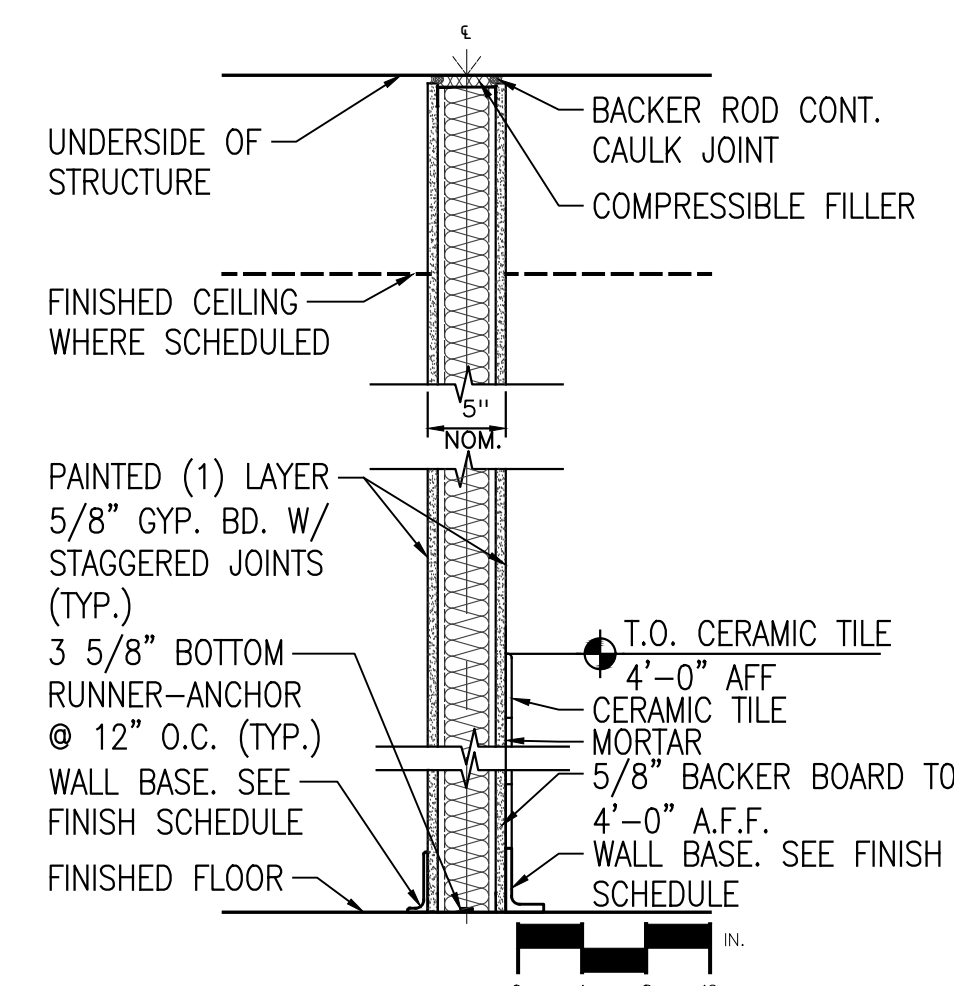


- 4C GYPSUM BOARD WALL PARTITION
GYP. BOARD BOTH SIDES
CERAMIC TILE & BACKER BOARD 1 SIDE
SOUND ATTENUATION BLANKET
NON-RATED (STC=55)
- 4E GYPSUM BOARD WALL PARTITION
7 5/8" STUD IN LIEU OF 3 5/8"

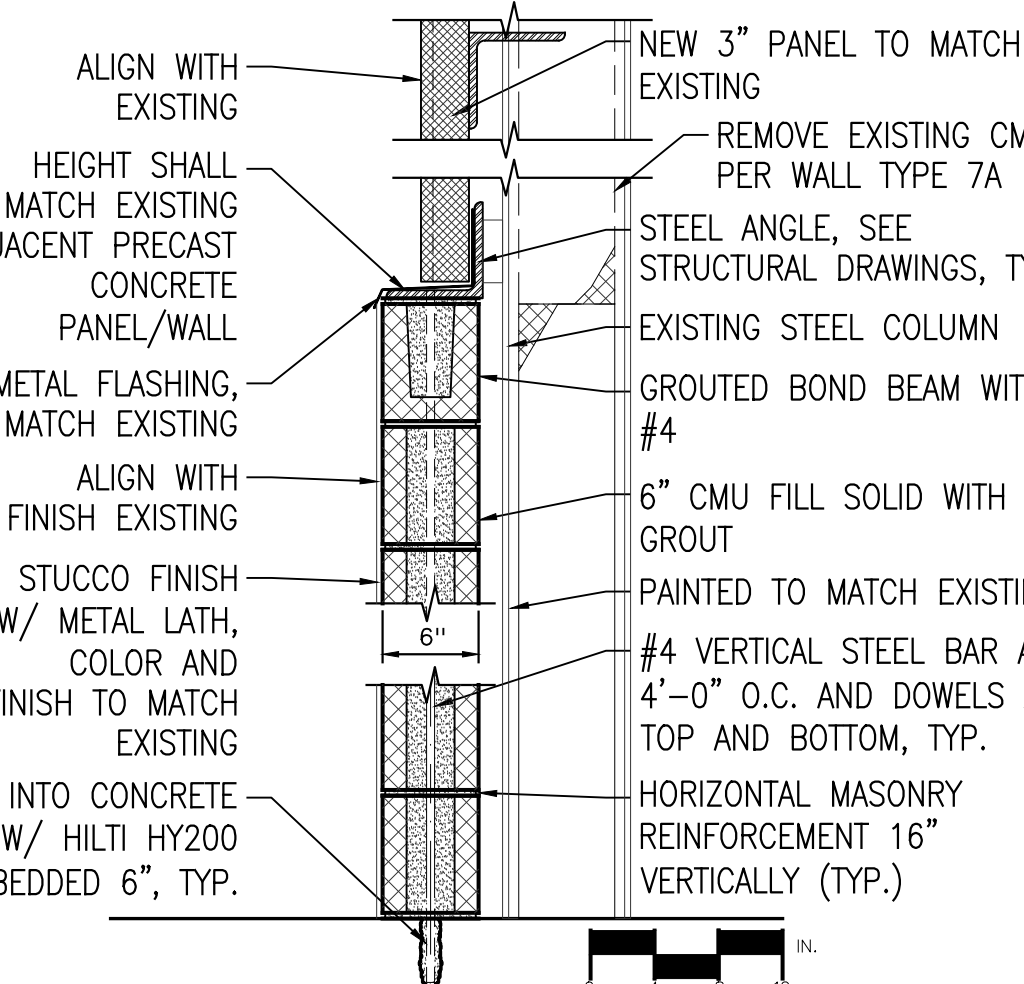


- 7 CONCRETE EXTERIOR WALL INFILL W/ REINFORCEMENT
6" GROUTED CONCRETE BLOCK
- 7A CONCRETE EXTERIOR WALL INFILL W/ REINFORCEMENT
6" GROUTED CONCRETE BLOCK.
REMOVE EXISTING CMU WALL ABOVE PRECAST HEIGHT.

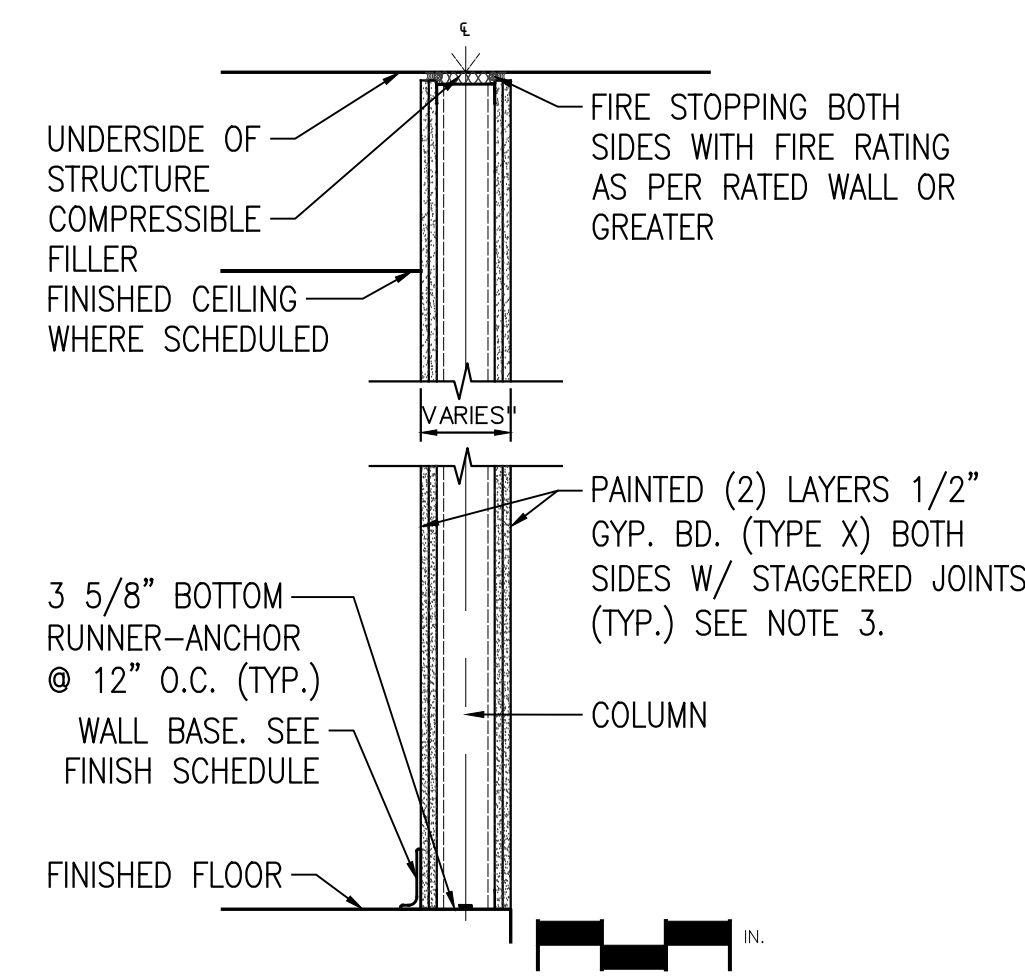

- 3E GYPSUM BOARD WALL PARTITION
2 HR. RATED (UL U-419)

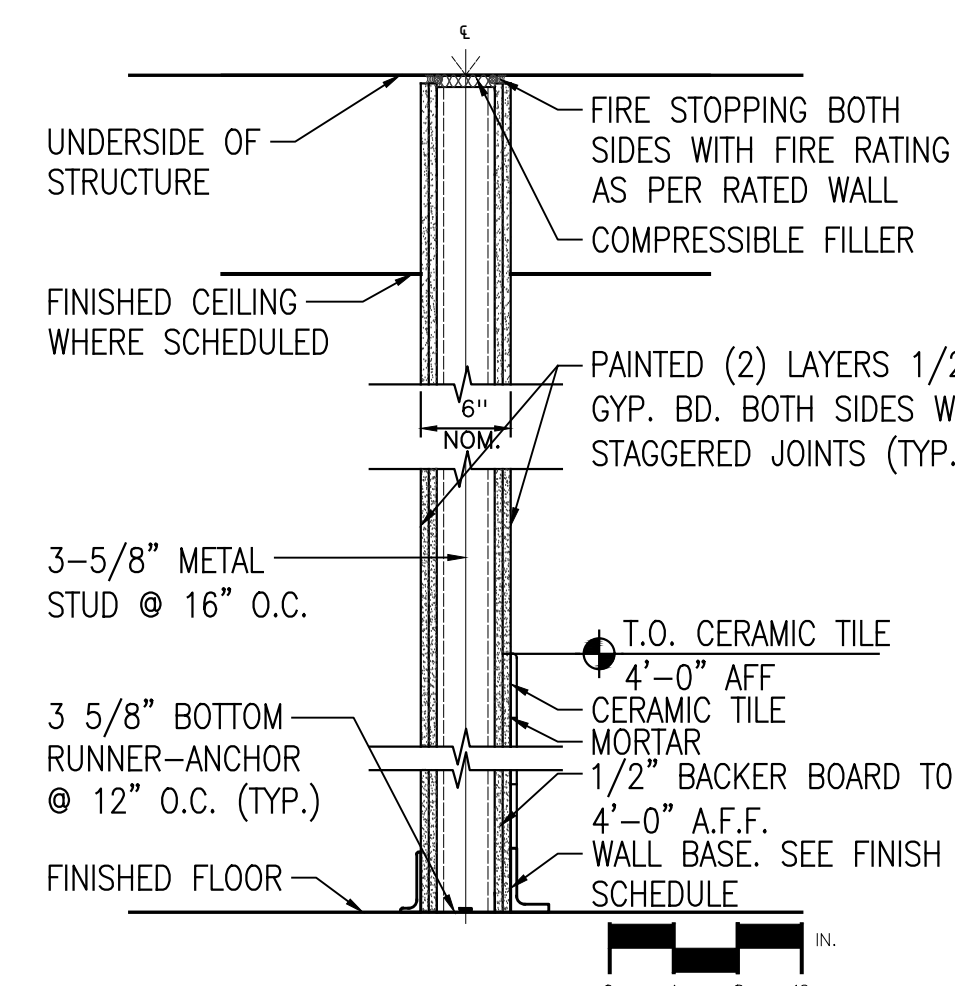

- 4D GYPSUM BOARD WALL PARTITION
2 LAYERS GYP. BOARD BOTH SIDE
CERAMIC TILE & BACKER BOARD 1 SIDE
2 HR RATED (UL U-419)

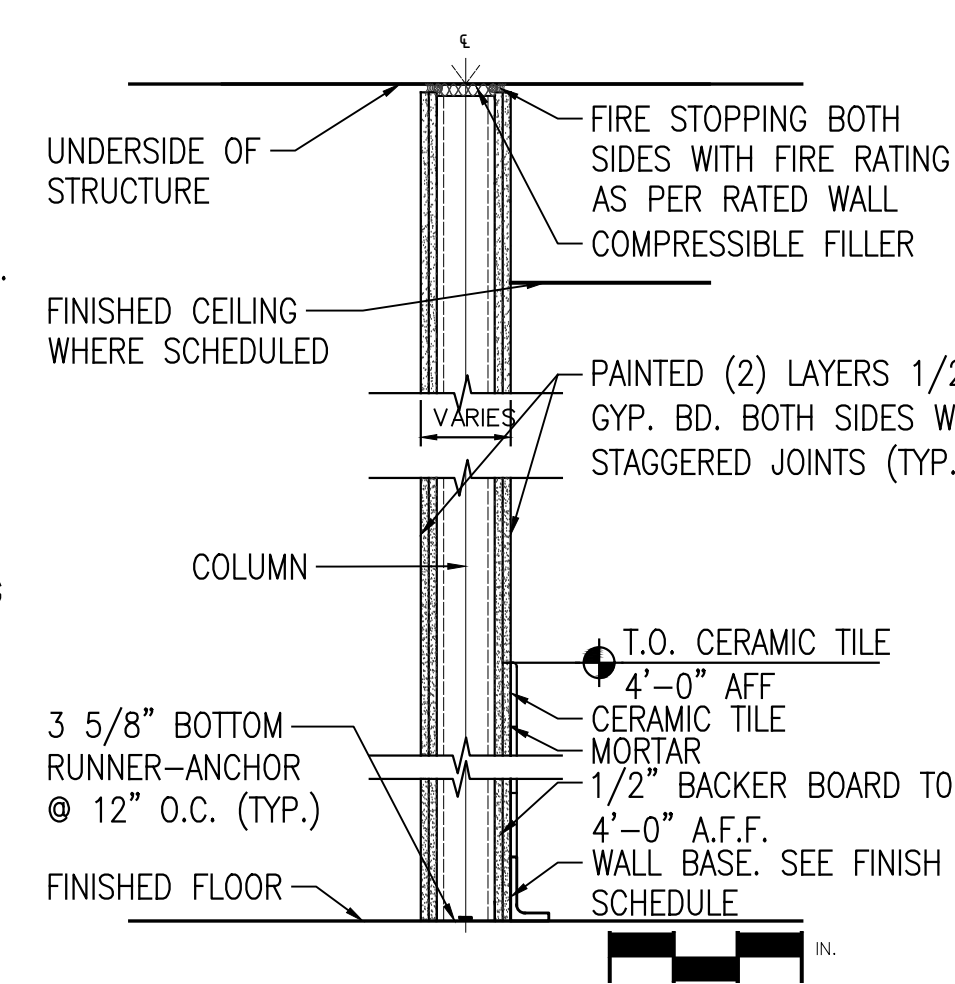

- 4E GYPSUM BOARD WALL PARTITION
2 LAYERS GYP. BOARD BOTH SIDE
CERAMIC TILE & BACKER BOARD 1 SIDE
2 HR RATED (UL U-419)

ARCHITECT
di Domenico + Partners LLP
Architecture
Landscape Architecture
Planning
3743 Crescent Street, 3rd Floor
Long Island City, New York 11101
Tel 212-337-0400
Fax 212-337-3567

CIVIL PLANNING ENGINEER
JMC
JMC Planning Engineering Landscape
Architecture & Land Surveying, PLLC
120 Bedford Road
Armonk, New York 10504
Tel 914-273-5225
Fax 914-273-2102

MEP ENGINEER
Burns
BURNS ENGINEERING, PC.
1261 Broadway, Suite 708
New York, New York 10001
Tel 212-962-3503

STRUCTURAL ENGINEER
GEI
GEISO
1385 Broadway, 20th FL
New York, New York 10018
Tel 212-687-8282



MANHATTAN BEER DISTRIBUTORS
20 DUNNIGAN DRIVE
SUFFERN, NEW YORK

REV	DESCRIPTION	DATE
-	ISSUED FOR DOB SUBMISSION	9.10.21
-	ISSUED FOR BID	10.15.21
-	ISSUED FOR CONSTRUCTION	11.30.21
-	REVISED BID SET	01.20.22
-	REVISED FOR CONSTRUCTION	04.05.22
-	PER METAL PANEL REDESIGN	07.26.22
-	REVISED FOR CONSTRUCTION	08.15.22

DRAWN BY: S. WOO
CHECKED BY: D. TOBAR, R.A.
APPROVED BY: A. BERGER, R.A.
DATE: 07.30.2021
SCALE: AS NOTED
DRAWING TITLE:

WALL TYPES

DWG NUMBER:

A-520