


WARNING:

THE ALTERATION OF THIS MATERIAL IN ANY WAY, UNLESS DONE UNDER THE DIRECTION OF A COMPARABLE PROFESSIONAL, I.E. ARCHITECT FOR AN ARCHITECT, ENGINEER FOR AN ENGINEER, OR LANDSCAPE ARCHITECT FOR A LANDSCAPE ARCHITECT, IS A VIOLATION OF THE NEW YORK STATE EDUCATION LAW AND/OR REGULATIONS AND IS A CLASS "A" MISDEMEANOR.

JOHN D. FELLENER, P.E.

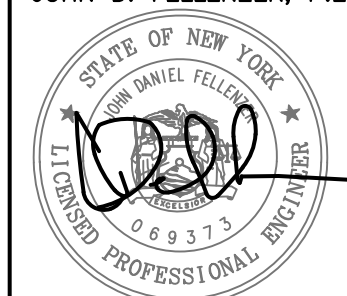

CONTRACT:

CONSTRUCTION

TITLE
REPLACE ROOF
DOT REGION 8, ORANGE COUNTYLOCATION:
NYS NEWBURGH DOT FACILITY
112 DICKSON STREET
NEWBURGH, NY 12550CLIENT:
NEW YORK STATE
DEPARTMENT OF TRANSPORTATION

FACADE REPAIR KEY NOTES

- PROTECTION MUST BE PROVIDED IN AREAS OF UNDERGOING WORK WHERE LIGHTING AND CAMERAS CURRENTLY EXISTS.
- REPLACE AND REPAIR ALL DETERIORATED AND DAMAGED MASONRY ON BUILDING FACADE, AREAS AS IDENTIFIED ON ELEVATIONS. REFER TO DETAILS ON A-702.
- RE-POINT MORTAR ON DETERIORATED AREAS OF BUILDING FACADE AND CHIMNEY. REFER TO DETAILS ON A-702.
- REMOVE 6' HIGH EXTERIOR STEEL CORNER GUARDS AT OVERHEAD DOORS. PROVIDE METAL "L" BRACKETS, IN MASONRY 16" O.C., AND CORNER GUARDS WELDED TO BRACKETS. PRIME CORNER GUARD WITH RUST PROOF PAINT & PAINT SAFETY YELLOW FINISH COAT.
- SCRAPE TO REMOVE RUST AND DEBRIS. PRIME WITH RUST PROOF PAINT AND PAINT SAFETY YELLOW. NO BRICK OR MORTAR REPAIRS ANTICIPATED THESE LOCATIONS.

NOTES:

- ITEMS NOTED ON FACADE ARE EXISTING TO REMAIN, UNLESS NOTED OTHERWISE. PROTECT FROM DAMAGE DURING RE-ROOFING AND FACADE WORK.
- EXISTING CONDITIONS DEPICTED ARE BASED ON LIMITED INFORMATION. CONTRACTOR SHALL NOTIFY DIRECTOR'S REPRESENTATIVE AFTER REMOVAL OPERATIONS ARE COMPLETE SO THAT CONDITIONS CAN BE VERIFIED.
- PROTECT SURROUNDING AREAS FROM PAINTING OPERATIONS. IMMEDIATELY REMOVE ANY EXCESS PAINT ON MASONRY.

ELEVATIONS

DRAWING NUMBER:

A-102

SHEET 5 OF 9

