

1 South Elevation
1/16" = 1'-0"


2 West Elevation
1/16" = 1'-0"

3 North Elevation
1/16" = 1'-0"

4 Partial East Elevation
1/16" = 1'-0"

General Elevation Notes

- A. PROVIDE MASONRY CLEANING AND REPOINTING AT AREAS OF HATCHED REGIONS.
- DASHED LINES REPRESENT APPROXIMATE LOCATIONS FOR THE FOLLOWING WORK: RAKE OUT HORIZONTAL MASONRY MORTAR JOINTS, REMOVE EXISTING EXPOSED JOINT REINFORCING 9 GA WIRE (VF), INSTALL NEW STAINLESS STEEL HELICAL TIES PER SPECIFICATION 04 01 20-19 AND REPOINT MORTAR JOINT.

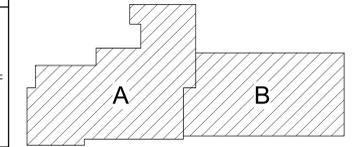

Key Plan
N.T.S.



S.E.D. Control No. 62-18-01-06-0-002-015

Rev. No.	Date	Description



complex world | CLEAR SOLUTIONS

Tetra Tech Engineers, Architects & Landscape Architects, P.C.

BID SET



Walkkill Central School District
Walkkill, New York

Reconstruction to:
John G. Borden Middle School

Exterior Elevations

Drawn By: TS	Date: 06/30/2023	Drawing Number: BA200
Project No.: 17597-22002		